


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

| | | | |
|-----------------------------------------|--------------------------|-----------------------------------------|------------------------|
| Intersection ID: 12048 | Main Street: S_GRAHAM_ST | Cross Street: W_3RD_ST | Location: W |
| ADA ID: F2B03D95E04E | Ramp Type: Perp | Initial Pass/Fail: Pass | Overall Compliance: No |
| Severity Score: 5 | | | |
| Codes/Mitigation Info/Possible Solution | | Field Measurements/Component Compliance | |

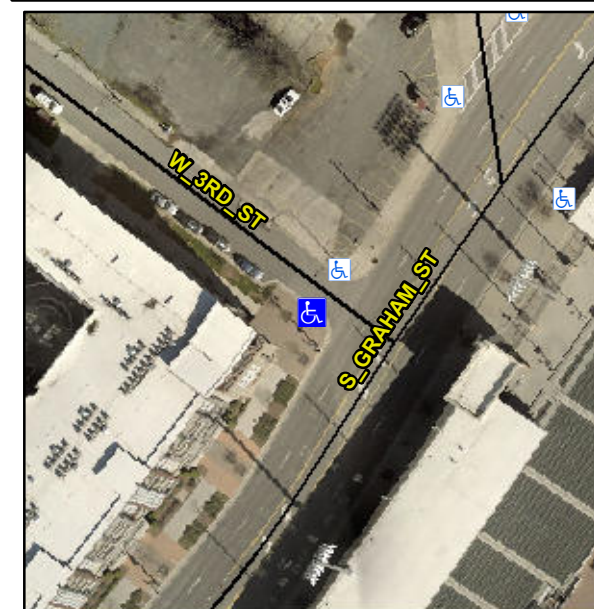

Possible Solutions:

Remove & Replace Entire Ramp.

Surveyor Notes:

N/A

PROW/ADA:

**R304.2.2-Perp, R304.3.2-Para,
R304.2.3, R305.2**

Total Cost: \$ 1850.00

| Compliance | Description | Data | Compliance | Description | Data |
|------------|-----------------------|------------------------|------------|-----------------------------|------|
| N/A | Ramp Length (in) | 67.0 | Yes | Ramp Slope (%) | 6.5 |
| Yes | Ramp Width (in) | 101.0 | Yes | Ramp XSlope (%) | 2.0 |
| No | Flare Type | Curbed_WithWalkSurface | No | Flare Type RT | N/A |
| No | Flare Slope LT (%) | N/A | N/A | Flare Slope RT (%) | N/A |
| N/A | Flare Traversable LT? | No | N/A | Flare Traversable RT? | No |
| Yes | Landing Length (in) | 60.0 | Yes | DWS Provided? | Yes |
| Yes | Landing Width (in) | 60.0 | Yes | DWS Contrast? | Yes |
| No | Landing Slope (%) | 2.8 | Yes | DWS Length (in) | 24.0 |
| Yes | Landing X Slope (%) | 0.9 | Yes | DWS Full Width? | Yes |
| N/A | Landing Curb? (Y/N) | No | No | DWS Offset (in) | 4.0 |
| N/A | Shared Landing? | No | | | |
| Yes | Gutter Ponding? | No | Yes | Gutter Slope (%) | 2.1 |
| Yes | Gutter Lip Ht (in) | 0.0 | Yes | Gutter X Slope (%) | 0.6 |
| N/A | Painted X Walk1? | No | N/A | Painted X Walk2? | N/A |
| | X Walk 1 Direction | To NE | | X Walk 2 Direction | N/A |
| N/A | X Walk 1 Width (in) | N/A | N/A | X Walk 2 Width (in) | N/A |
| | X Walk 1 Slope (%) | 3.1 | | X Walk 2 Slope (%) | N/A |
| | X Walk 1 X Slope (%) | 1.5 | | X Walk 2 X Slope (%) | N/A |
| N/A | Ramp inside XWalk1? | N/A | N/A | Ramp inside XWalk2? | N/A |
| | Road Slope (%) | N/A | N/A | Clear Space? | Yes |
| | Road X Slope (%) | N/A | N/A | Clear Space to XWalk (in) | N/A |
| Yes | Any Obstructions? | No | Yes | Storm Grate/Utility Hazard? | No |
| | Obstruction Type | | | Storm Grate/Utility Type | |
| | | N/A | | | N/A |
| | | | Yes | Surface Condition? (G/P) | Good |

