


Access Compliance Report Public Rights-of-Way (Curb Ramps)



Intersection ID: 3985 Main Street: ARMITAGE DR **Cross Street: ARMITAGE DR** Location: W **ADA ID: F32EDF16EBEF** Ramp Type: Directional1 Initial Pass/Fail: Pass **Overall Compliance: No Severity Score:** 15

Codes/Mitigation Info/Possible Solution

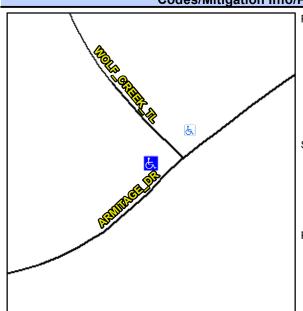

WOLF CREEK TL Street 1 Name Stop Condition-Street 1 StopSign Street 2 Name N/A Stop Condition-Street 2 N/A Possible Solutions: Remove & Replace Entire Ramp. Remove & Replace Gutter. Surveyor Notes: N/A PROW/ADA: Not Found, R304.2.2-Perp, R304.3.2-Para, R304.5.3, R304.5.2, R305.2, R302.7.2

Total Cost: 2350.00

| Field Measurements/Component Compliance | | | | | |
|---|-----------------------|-------|------|-----------------------------|------|
| Compliance Description | | Data | Comp | liance Description | Data |
| N/A | Ramp Length (in) | 61.0 | No | Grade Break? | No |
| Yes | Ramp Width (in) | 49.0 | N/A | Grade Break Slope (%) | N/A |
| Yes | Ramp Slope (%) | 5.4 | N/A | Grade Break XSlope (%) | N/A |
| Yes | Ramp XSlope (%) | 1.3 | | | |
| N/A | Flare Type LT | N/A | N/A | Flare Type RT | N/A |
| N/A | Flare Slope LT (%) | 3.3 | N/A | Flare Slope RT (%) | 10.3 |
| N/A | Flare Traversable LT? | No | N/A | Flare Traversable RT? | No |
| Yes | Landing Length (in) | 60.0 | Yes | DWS Provided? | Yes |
| Yes | Landing Width (in) | 48.0 | Yes | DWS Contrast? | Yes |
| No | Landing Slope (%) | 4.4 | Yes | DWS Length (in) | 25.5 |
| No | Landing X Slope (%) | 2.9 | Yes | DWS Full Width? | Yes |
| N/A | Landing Curb? (Y/N) | N/A | Yes | DWS Offset LT (in) | 1.0 |
| N/A | Shared Landing? | No | No | DWS Offset RT (in) | 71.0 |
| Yes | Gutter Ponding? | No | Yes | Gutter Slope (%) | 3.7 |
| No | Gutter Lip Ht (in) | 1.5 | No | Gutter X Slope (%) | 7.1 |
| N/A | Painted X Walk1? | No | | Road Slope (%) | 5.4 |
| | X Walk 1 Direction | To NE | | Road X Slope (%) | 4.1 |
| | X Walk 1 Width (in) | N/A | | Clear Space? | Yes |
| | X Walk 1 Slope (%) | 5.4 | N/A | Clear Space to XWalk (in) | N/A |
| | X Walk 1 X Slope (%) | 4.1 | Yes | Storm Grate/Utility Hazard? | No |
| N/A | Ramp inside XWalk1? | N/A | | Storm Grate/Utility Type | |
| Yes | Any Obstructions? | No | | | N/A |
| | Obstruction Type | | Yes | Surface Condition? (G/P) | Good |
| | | N/A | No | Curb Slope (%) | 16.3 |
| | | | | | |





