


Intersection ID: 8344	Main Street: KENNESAW_DR	Cross Street: CATHERINE_SIMMONS_AV	Location:	NW
ADA ID: F341C6B4B136	Ramp Type: PerpDiag	Initial Pass/Fail: Fail	Overall Compliance: No	Severity Score: 12.5

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance																																																																													
 <div>Street 1 Name CATHERINE SIMMONS AV</div> <div>Stop Condition-Street 1 None</div> <div>Street 2 Name KENNESAW DR</div> <div>Stop Condition-Street 2 StopSign</div>			Possible Solutions:			<table><tr><th>Compliance</th><th>Description</th><th>Data</th></tr><tr><td>N/A</td><td>Ramp Length (in)</td><td>37.5</td></tr><tr><td>Yes</td><td>Ramp Width (in)</td><td>48.0</td></tr><tr><td>N/A</td><td>Flare Type LT</td><td>N/A</td></tr><tr><td>N/A</td><td>Flare Slope LT (%)</td><td>N/A</td></tr><tr><td>N/A</td><td>Flare Traversable LT?</td><td>N/A</td></tr><tr><td>N/A</td><td>Landing Length (in)</td><td>N/A</td></tr><tr><td>N/A</td><td>Landing Width (in)</td><td>N/A</td></tr><tr><td>N/A</td><td>Landing Slope (%)</td><td>N/A</td></tr><tr><td>N/A</td><td>Landing X Slope (%)</td><td>N/A</td></tr><tr><td>N/A</td><td>Landing Curb? (Y/N)</td><td>N/A</td></tr><tr><td>N/A</td><td>Shared Landing?</td><td>N/A</td></tr><tr><td>N/A</td><td>Gutter Ponding?</td><td>N/A</td></tr><tr><td>N/A</td><td>Gutter Lip Ht (in)</td><td>N/A</td></tr><tr><td>N/A</td><td>Painted X Walk1?</td><td>No</td></tr><tr><td></td><td>X Walk 1 Direction</td><td>To S</td></tr><tr><td>N/A</td><td>X Walk 1 Width (in)</td><td>N/A</td></tr><tr><td></td><td>X Walk 1 Slope (%)</td><td>1.9</td></tr><tr><td></td><td>X Walk 1 X Slope (%)</td><td>4.5</td></tr><tr><td>N/A</td><td>Ramp inside XWalk1?</td><td>N/A</td></tr><tr><td></td><td>Road Slope (%)</td><td>0.6</td></tr><tr><td></td><td>Road X Slope (%)</td><td>2.9</td></tr><tr><td>N/A</td><td>Any Obstructions?</td><td>N/A</td></tr><tr><td></td><td>Obstruction Type</td><td></td></tr></table>			Compliance	Description	Data	N/A	Ramp Length (in)	37.5	Yes	Ramp Width (in)	48.0	N/A	Flare Type LT	N/A	N/A	Flare Slope LT (%)	N/A	N/A	Flare Traversable LT?	N/A	N/A	Landing Length (in)	N/A	N/A	Landing Width (in)	N/A	N/A	Landing Slope (%)	N/A	N/A	Landing X Slope (%)	N/A	N/A	Landing Curb? (Y/N)	N/A	N/A	Shared Landing?	N/A	N/A	Gutter Ponding?	N/A	N/A	Gutter Lip Ht (in)	N/A	N/A	Painted X Walk1?	No		X Walk 1 Direction	To S	N/A	X Walk 1 Width (in)	N/A		X Walk 1 Slope (%)	1.9		X Walk 1 X Slope (%)	4.5	N/A	Ramp inside XWalk1?	N/A		Road Slope (%)	0.6		Road X Slope (%)	2.9	N/A	Any Obstructions?	N/A		Obstruction Type	
			Compliance	Description	Data																																																																											
			N/A	Ramp Length (in)	37.5																																																																											
			Yes	Ramp Width (in)	48.0																																																																											
			N/A	Flare Type LT	N/A																																																																											
N/A	Flare Slope LT (%)	N/A																																																																														
N/A	Flare Traversable LT?	N/A																																																																														
N/A	Landing Length (in)	N/A																																																																														
N/A	Landing Width (in)	N/A																																																																														
N/A	Landing Slope (%)	N/A																																																																														
N/A	Landing X Slope (%)	N/A																																																																														
N/A	Landing Curb? (Y/N)	N/A																																																																														
N/A	Shared Landing?	N/A																																																																														
N/A	Gutter Ponding?	N/A																																																																														
N/A	Gutter Lip Ht (in)	N/A																																																																														
N/A	Painted X Walk1?	No																																																																														
	X Walk 1 Direction	To S																																																																														
N/A	X Walk 1 Width (in)	N/A																																																																														
	X Walk 1 Slope (%)	1.9																																																																														
	X Walk 1 X Slope (%)	4.5																																																																														
N/A	Ramp inside XWalk1?	N/A																																																																														
	Road Slope (%)	0.6																																																																														
	Road X Slope (%)	2.9																																																																														
N/A	Any Obstructions?	N/A																																																																														
	Obstruction Type																																																																															
Surveyor Notes:			<table><tr><th>Compliance</th><th>Description</th><th>Data</th></tr><tr><td>No</td><td>Ramp Slope (%)</td><td>11.9</td></tr><tr><td>Yes</td><td>Ramp XSlope (%)</td><td>0.1</td></tr><tr><td>N/A</td><td>Flare Type RT</td><td>N/A</td></tr><tr><td>N/A</td><td>Flare Slope RT (%)</td><td>N/A</td></tr><tr><td>N/A</td><td>Flare Traversable RT?</td><td>N/A</td></tr><tr><td>N/A</td><td>DWS Provided?</td><td>N/A</td></tr><tr><td>N/A</td><td>DWS Contrast?</td><td>N/A</td></tr><tr><td>N/A</td><td>DWS Length (in)</td><td>N/A</td></tr><tr><td>N/A</td><td>DWS Full Width?</td><td>N/A</td></tr><tr><td>N/A</td><td>DWS Offset (in)</td><td>N/A</td></tr><tr><td>N/A</td><td>Gutter Slope (%)</td><td>N/A</td></tr><tr><td>N/A</td><td>Gutter X Slope (%)</td><td>N/A</td></tr><tr><td>N/A</td><td>Painted X Walk2?</td><td>No</td></tr><tr><td></td><td>X Walk 2 Direction</td><td>To E</td></tr><tr><td>N/A</td><td>X Walk 2 Width (in)</td><td>N/A</td></tr><tr><td></td><td>X Walk 2 Slope (%)</td><td>2.5</td></tr><tr><td></td><td>X Walk 2 X Slope (%)</td><td>1.3</td></tr><tr><td>N/A</td><td>Ramp inside XWalk2?</td><td>N/A</td></tr><tr><td>N/A</td><td>Clear Space?</td><td>N/A</td></tr><tr><td>N/A</td><td>Clear Space to XWalk (in)</td><td>N/A</td></tr><tr><td>N/A</td><td>Storm Grate/Utility Hazard?</td><td>N/A</td></tr><tr><td></td><td>Storm Grate/Utility Type</td><td></td></tr></table>			Compliance	Description	Data	No	Ramp Slope (%)	11.9	Yes	Ramp XSlope (%)	0.1	N/A	Flare Type RT	N/A	N/A	Flare Slope RT (%)	N/A	N/A	Flare Traversable RT?	N/A	N/A	DWS Provided?	N/A	N/A	DWS Contrast?	N/A	N/A	DWS Length (in)	N/A	N/A	DWS Full Width?	N/A	N/A	DWS Offset (in)	N/A	N/A	Gutter Slope (%)	N/A	N/A	Gutter X Slope (%)	N/A	N/A	Painted X Walk2?	No		X Walk 2 Direction	To E	N/A	X Walk 2 Width (in)	N/A		X Walk 2 Slope (%)	2.5		X Walk 2 X Slope (%)	1.3	N/A	Ramp inside XWalk2?	N/A	N/A	Clear Space?	N/A	N/A	Clear Space to XWalk (in)	N/A	N/A	Storm Grate/Utility Hazard?	N/A		Storm Grate/Utility Type							
Compliance	Description	Data																																																																														
No	Ramp Slope (%)	11.9																																																																														
Yes	Ramp XSlope (%)	0.1																																																																														
N/A	Flare Type RT	N/A																																																																														
N/A	Flare Slope RT (%)	N/A																																																																														
N/A	Flare Traversable RT?	N/A																																																																														
N/A	DWS Provided?	N/A																																																																														
N/A	DWS Contrast?	N/A																																																																														
N/A	DWS Length (in)	N/A																																																																														
N/A	DWS Full Width?	N/A																																																																														
N/A	DWS Offset (in)	N/A																																																																														
N/A	Gutter Slope (%)	N/A																																																																														
N/A	Gutter X Slope (%)	N/A																																																																														
N/A	Painted X Walk2?	No																																																																														
	X Walk 2 Direction	To E																																																																														
N/A	X Walk 2 Width (in)	N/A																																																																														
	X Walk 2 Slope (%)	2.5																																																																														
	X Walk 2 X Slope (%)	1.3																																																																														
N/A	Ramp inside XWalk2?	N/A																																																																														
N/A	Clear Space?	N/A																																																																														
N/A	Clear Space to XWalk (in)	N/A																																																																														
N/A	Storm Grate/Utility Hazard?	N/A																																																																														
	Storm Grate/Utility Type																																																																															
PROW/ADA:																																																																																
Not Found, R304.2.2																																																																																
Total Cost:			\$ 3200.00																																																																													
			N/A																																																																													
			Yes																																																																													

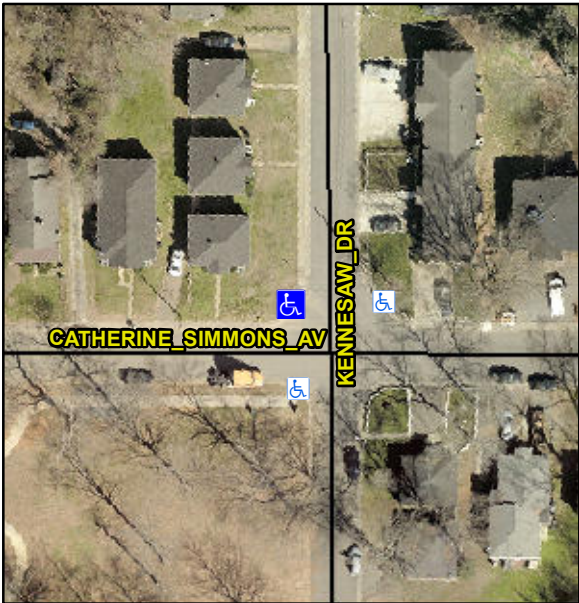