

Access Compliance Report


Public Rights-of-Way

(Curb Ramps)

Intersection ID: 45563	Main Street: MT_HOLLY-HUNTERSVILLE_RD	Cross Street: MOUNT_HOLLY_RD	Location:	N
ADA ID: F3CFC238F9DD	Ramp Type: PerpDiag	Initial Pass/Fail: Pass	Overall Compliance: No	Severity Score: 2.5

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

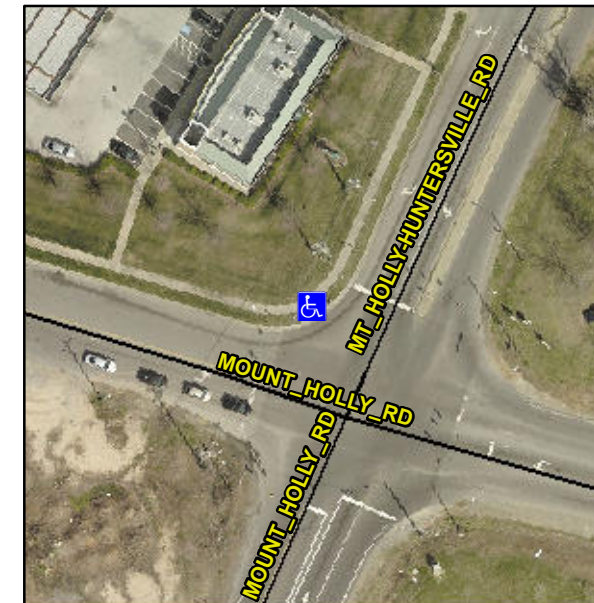

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

N/A

PROW/ADA:

R304.2.1, R304.2.2-Perp, R304.3.2-Para, R305.1.4, R305.2

Total Cost: \$ 3200.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	17.0	Yes	Ramp Slope (%)	7.4
Yes	Ramp Width (in)	55.0	Yes	Ramp XSlope (%)	0.7
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	8.5	N/A	Flare Slope RT (%)	3.8
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
Yes	Landing Length (in)	60.0	Yes	DWS Provided?	Yes
No	Landing Width (in)	47.0	Yes	DWS Contrast?	Yes
No	Landing Slope (%)	3.6	Yes	DWS Length (in)	25.0
Yes	Landing X Slope (%)	1.2	No	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	No	No	DWS Offset (in)	3.5
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	0.6
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	1.9
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To SE		X Walk 2 Direction	To SW
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	0.7		X Walk 2 Slope (%)	0.7
	X Walk 1 X Slope (%)	1.2		X Walk 2 X Slope (%)	2.0
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	0.6	N/A	Clear Space?	Yes
	Road X Slope (%)	1.1	N/A	Clear Space to XWalk (in)	31.0
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good

Street 1 Name MOUNT HOLLY RD
 Stop Condition-Street 2 Signal
 Street 2 Name MT HOLLY HUNTERSVILLE RD
 Stop Condition-Street 1 Signal

