


# Access Compliance Report Public Rights-of-Way (Curb Ramps)

Intersection ID: 3992	Main Street: BENTHAVEN_LN	Cross Street: BROWNE'S_FERRY_RD	Location: SE
ADA ID: F3D224A61BAB	Ramp Type: Perp	Initial Pass/Fail: Pass	Overall Compliance: No Severity Score: 10

Codes/Mitigation Info/Possible Solution	Field Measurements/Component Compliance
---	---

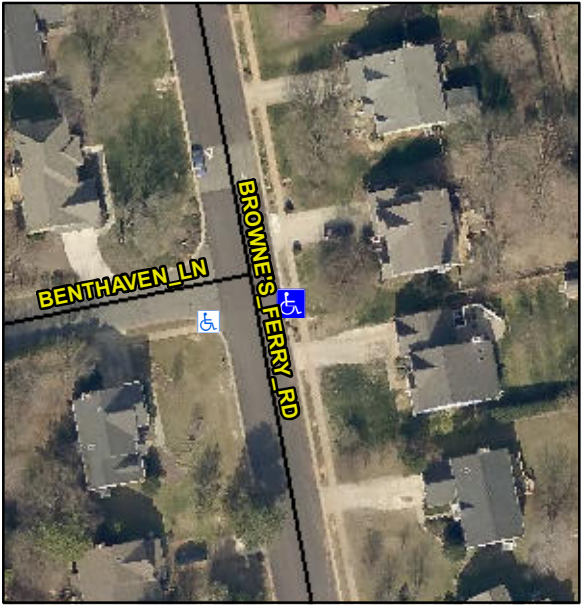

Possible Solutions:  
**Remove & Replace Entire Ramp.**

Surveyor Notes:  
**N/A**

PROW/ADA:  
**Not Found, R304.2.2-Perp, R304.3.2-Para, R304.5.3, R305**

Street 1 Name	<b>BROWNS FERRY RD</b>
Stop Condition-Street 2	<b>None</b>
Street 2 Name	<b>N/A</b>
Stop Condition-Street 1	<b>N/A</b>

Total Cost: \$ **1850.00**

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	48.0	Yes	Ramp Slope (%)	7.8
Yes	Ramp Width (in)	48.0	Yes	Ramp XSlope (%)	1.7
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	6.0	Yes	Flare Slope RT (%)	7.9
N/A	Flare Traversable LT?	Yes	N/A	Flare Traversable RT?	Yes
Yes	Landing Length (in)	48.0	No	DWS Provided?	No
Yes	Landing Width (in)	64.5	N/A	DWS Contrast?	No
No	Landing Slope (%)	3.4	N/A	DWS Length (in)	N/A
No	Landing X Slope (%)	2.4	N/A	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	No	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	1.9
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	1.1
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To W		X Walk 2 Direction	N/A
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	5.8		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	1.2		X Walk 2 X Slope (%)	N/A
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	N/A	N/A	Clear Space?	Yes
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good

