


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 52450	Main Street: TRANQUIL_OAK_PL	Cross Street: MOSS_LN	Location: NE
ADA ID: F3DF531E90B1	Ramp Type: Directional1	Initial Pass/Fail: Pass	Overall Compliance: No
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	
Severity Score: 17.5			

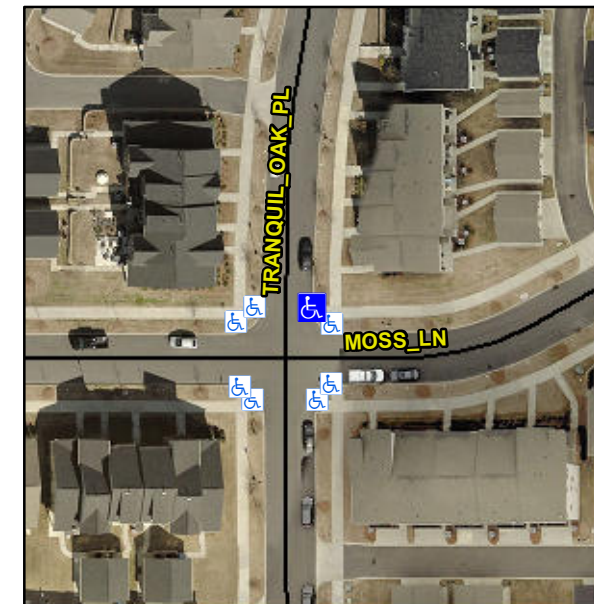

Possible Solutions:

**Remove & Replace Entire Ramp.
Remove & Replace Gutter.**

Surveyor Notes:

N/A

PROW/ADA:

R304.5.3, R305.1.4, R302.7.2

Total Cost: \$ 2350.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	83.0	Yes	Grade Break?	Yes
Yes	Ramp Width (in)	67.0	No	Grade Break Slope (%)	5.4
Yes	Ramp Slope (%)	2.9	No	Grade Break XSlope (%)	2.6
Yes	Ramp XSlope (%)	1.3			
Yes	Flare Type LT	N/A	Yes	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
Yes	Landing Length (in)	70.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	78.0	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	0.1	Yes	DWS Length (in)	24.0
Yes	Landing X Slope (%)	0.6	No	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	No	Yes	DWS Offset LT (in)	6.5
N/A	Shared Landing?	Yes	Yes	DWS Offset RT (in)	1.0
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	0.8
No	Gutter Lip Ht (in)	1.0	No	Gutter X Slope (%)	2.8
N/A	Painted X Walk1?	No		Road Slope (%)	3.9
	X Walk 1 Direction	To W		Road X Slope (%)	1.1
	X Walk 1 Width (in)	N/A		Clear Space?	Yes
	X Walk 1 Slope (%)	3.9	N/A	Clear Space to XWalk (in)	N/A
	X Walk 1 X Slope (%)	1.1	Yes	Storm Grate/Utility Hazard?	No
N/A	Ramp inside XWalk1?	N/A		Storm Grate/Utility Type	
Yes	Any Obstructions?	No			N/A
	Obstruction Type		Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	8.1

