

Access Compliance Report


Public Rights-of-Way

(Curb Ramps)

Intersection ID: 10025537	Main Street: E_STONEWALL_ST	Cross Street: N/A	Location: NE
ADA ID: F474082F7122	Ramp Type: Directional1	Initial Pass/Fail: Pass	Overall Compliance: No
			Severity Score: 2.5

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

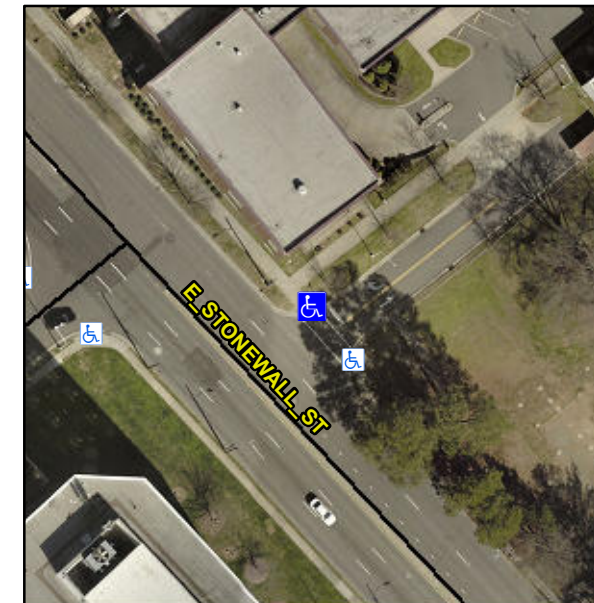

Possible Solutions:

**Remove & Replace Entire Ramp.
Remove & Replace Gutter.**

Surveyor Notes:

N/A

PROW/ADA:

R304.2.2, R304.5.2, R304.5.3

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	132.0	No	Grade Break?	No
Yes	Ramp Width (in)	90.0	N/A	Grade Break Slope (%)	0.0
No	Ramp Slope (%)	8.8	N/A	Grade Break XSlope (%)	N/A
Yes	Ramp XSlope (%)	1.4			
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	6.6	N/A	Flare Slope RT (%)	0.3
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
Yes	Landing Length (in)	95.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	92.0	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	1.3	Yes	DWS Length (in)	24.0
Yes	Landing X Slope (%)	1.3	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	N/A	Yes	DWS Offset LT (in)	0.0
N/A	Shared Landing?	Yes	Yes	DWS Offset RT (in)	0.0
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	3.0
Yes	Gutter Lip Ht (in)	0.0	No	Gutter X Slope (%)	4.4
N/A	Painted X Walk1?	Yes		Road Slope (%)	0.2
	X Walk 1 Direction	To SE		Road X Slope (%)	4.0
	X Walk 1 Width (in)	104.0		Clear Space?	Yes
	X Walk 1 Slope (%)	0.2	N/A	Clear Space to XWalk (in)	N/A
	X Walk 1 X Slope (%)	4.0	Yes	Storm Grate/Utility Hazard?	No
Yes	Ramp inside XWalk1?	Yes		Storm Grate/Utility Type	
Yes	Any Obstructions?	No			N/A
	Obstruction Type		Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	8.0

Total Cost: \$ 2350.00

Street 1 Name	ENTRANCE
Stop Condition-Street 1	StopSign
Street 2 Name	N/A
Stop Condition-Street 2	N/A

