

Access Compliance Report


Public Rights-of-Way

(Curb Ramps)

Intersection ID: 47271	Main Street: SAVANNAH_HILLS_DR	Cross Street: LIDDINGTON_RD	Location: SW
ADA ID: F4741073CE2B	Ramp Type: BlendTrans1	Initial Pass/Fail: Pass	Overall Compliance: No
		Severity Score: 15	

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

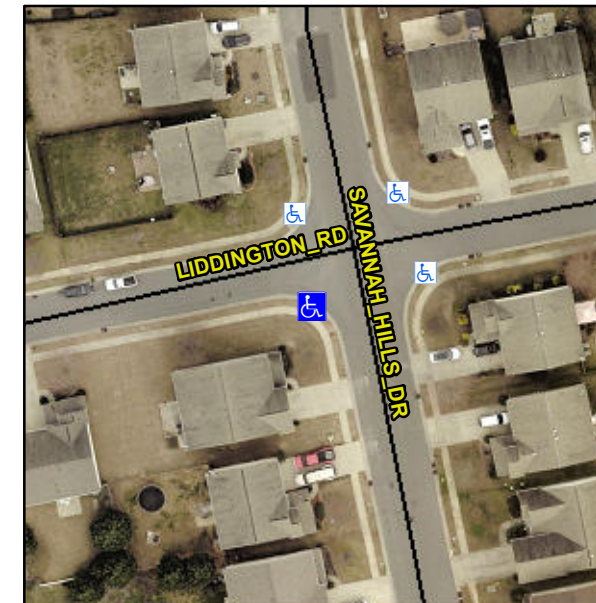

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter.

Surveyor Notes:

N/A

PROW/ADA:

Not Found, R304.2.1, R305, R304.5.4

Total Cost: \$ 3950.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	49.0	Yes	BlendTrans Slope (%)	2.8
Yes	Ramp Width (in)	60.0	Yes	BlendTrans XSlope (%)	0.4
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	Sloped
N/A	Flare Slope LT (%)	0.2	N/A	Flare Slope RT (%)	1.3
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
No	Landing Length (in)	47.0	No	DWS Provided?	No
Yes	Landing Width (in)	60.0	N/A	DWS Contrast?	No
Yes	Landing Slope (%)	1.3	N/A	DWS Length (in)	N/A
Yes	Landing X Slope (%)	1.4	N/A	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	No	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	No	Gutter Slope (%)	6.7
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	0.9
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To E		X Walk 2 Direction	To N
	X Walk 1 Width (in)	N/A		X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	3.2		X Walk 2 Slope (%)	5.3
	X Walk 1 X Slope (%)	3.3		X Walk 2 X Slope (%)	2.6
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	0.8		Clear Space?	Yes
	Road X Slope (%)	4.6	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			No	Curb Slope (%)	12.7

Street 1 Name SAVANNAH HILLS DR
 Stop Condition-Street 1 None
 Street 2 Name LIDDINGTON RD
 Stop Condition-Street 2 StopSign

