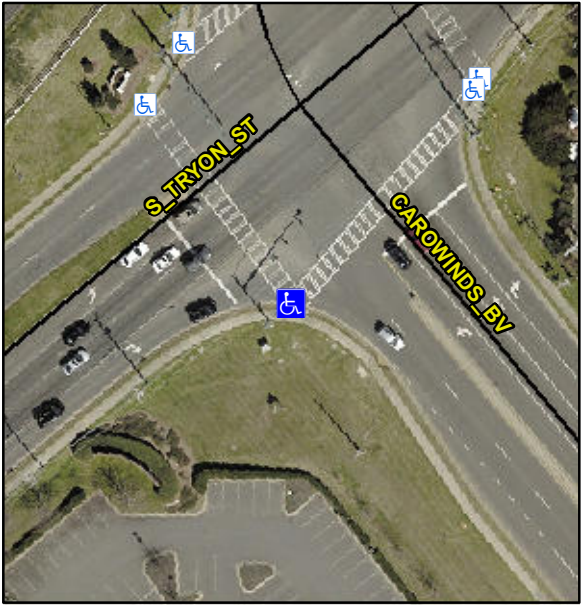


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 23277	Main Street: S_TRYON_ST	Cross Street: CAROWINDS_BV	Location: SW
ADA ID: F47ADC41403E	Ramp Type: PerpDiag	Initial Pass/Fail: Fail	Overall Compliance: No
			Severity Score: 13.75

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance		
	Possible Solutions:		Compliance	Description	Data
	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.		No	Ramp Length (in)	66.0
			Yes	Ramp Width (in)	48.0
			N/A	Flare Type LT	N/A
			N/A	Flare Slope LT (%)	N/A
			N/A	Flare Traversable LT?	N/A
			N/A	Landing Length (in)	N/A
			N/A	Landing Width (in)	N/A
			N/A	Landing Slope (%)	N/A
			N/A	Landing X Slope (%)	N/A
<p>Surveyor Notes:</p> <p>N/A</p> <p>PROW/ADA:</p> <p>R304.2.2, R304.5.3</p>			N/A	Flare Type RT	N/A
			N/A	Flare Slope RT (%)	N/A
			N/A	Flare Traversable RT?	N/A
			N/A	DWS Provided?	N/A
			N/A	DWS Contrast?	N/A
			N/A	DWS Length (in)	N/A
			N/A	DWS Full Width?	N/A
			N/A	DWS Offset (in)	N/A
			N/A	Gutter Ponding?	N/A
			N/A	Gutter Lip Ht (in)	N/A
<p>Total Cost:</p> <p>\$ 3200.00</p>			Yes	Painted X Walk1?	Yes
				X Walk 1 Direction	To NE
			N/A	X Walk 1 Width (in)	113.0
				X Walk 1 Slope (%)	1.9
				X Walk 1 X Slope (%)	2.5
			N/A	Ramp inside XWalk1?	Yes
				Road Slope (%)	2.0
				Road X Slope (%)	2.3
			N/A	Any Obstructions?	N/A
				Obstruction Type	
<p>Street 1 Name</p> <p>CAROWINDS BV</p> <p>Stop Condition-Street 2</p> <p>Signal</p> <p>Street 2 Name</p> <p>S TRYON ST</p> <p>Stop Condition-Street 1</p> <p>Signal</p>			N/A	Clear Space?	N/A
			N/A	Clear Space to XWalk (in)	N/A
			N/A	Storm Grate/Utility Hazard?	N/A
				Storm Grate/Utility Type	
			N/A		N/A
			Yes	Surface Condition? (G/P)	Good

