


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

|   |                                  |   |                        |
|---|----------------------------------|---|------------------------|
| Intersection ID: 42489                  | Main Street: ALEXANDER MARTIN AV | Cross Street: LINA ARDREY LN            | Location: SW           |
| ADA ID: F49EBC220BF7                    | Ramp Type: PerpDiag              | Initial Pass/Fail: Fail                 | Overall Compliance: No |
| Severity Score: 17.5                    |                                  |   |                        |
| Codes/Mitigation Info/Possible Solution |                                  | Field Measurements/Component Compliance |                        |

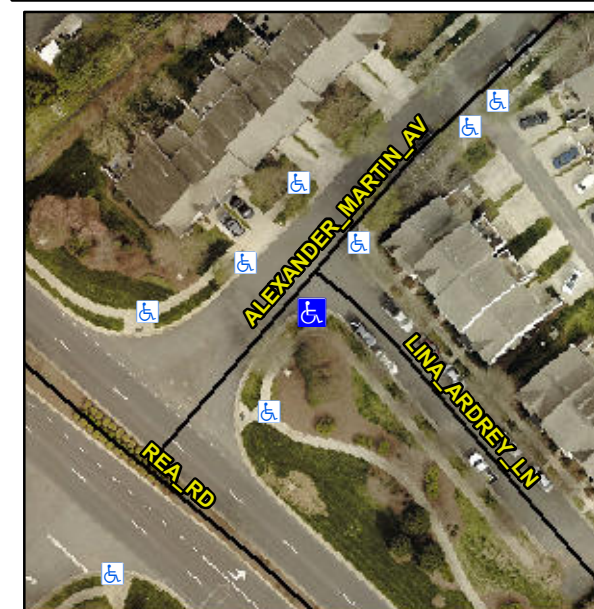

Possible Solutions:

**Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.**

Surveyor Notes:

**N/A**

PROW/ADA:

**R304.5.1**

Total Cost: \$ 3200.00

| Compliance | Description           | Data  | Compliance | Description                 | Data  |
|------------|-----------------------|-------|------------|-----------------------------|-------|
| N/A        | Ramp Length (in)      | 85.5  | Yes        | Ramp Slope (%)              | 8.0   |
| No         | Ramp Width (in)       | 35.0  | Yes        | Ramp XSlope (%)             | 1.1   |
| N/A        | Flare Type LT         | N/A   | N/A        | Flare Type RT               | N/A   |
| N/A        | Flare Slope LT (%)    | N/A   | N/A        | Flare Slope RT (%)          | N/A   |
| N/A        | Flare Traversable LT? | N/A   | N/A        | Flare Traversable RT?       | N/A   |
| N/A        | Landing Length (in)   | N/A   | N/A        | DWS Provided?               | N/A   |
| N/A        | Landing Width (in)    | N/A   | N/A        | DWS Contrast?               | N/A   |
| N/A        | Landing Slope (%)     | N/A   | N/A        | DWS Length (in)             | N/A   |
| N/A        | Landing X Slope (%)   | N/A   | N/A        | DWS Full Width?             | N/A   |
| N/A        | Landing Curb? (Y/N)   | N/A   | N/A        | DWS Offset (in)             | N/A   |
| N/A        | Shared Landing?       | N/A   |            |                             |       |
| N/A        | Gutter Ponding?       | N/A   | N/A        | Gutter Slope (%)            | N/A   |
| N/A        | Gutter Lip Ht (in)    | N/A   | N/A        | Gutter X Slope (%)          | N/A   |
| N/A        | Painted X Walk1?      | No    | N/A        | Painted X Walk2?            | No    |
|            | X Walk 1 Direction    | To NE |            | X Walk 2 Direction          | To NW |
| N/A        | X Walk 1 Width (in)   | N/A   | N/A        | X Walk 2 Width (in)         | N/A   |
|            | X Walk 1 Slope (%)    | 2.6   |            | X Walk 2 Slope (%)          | 4.3   |
|            | X Walk 1 X Slope (%)  | 2.2   |            | X Walk 2 X Slope (%)        | 2.2   |
| N/A        | Ramp inside XWalk1?   | N/A   | N/A        | Ramp inside XWalk2?         | N/A   |
|            | Road Slope (%)        | 0.2   | N/A        | Clear Space?                | N/A   |
|            | Road X Slope (%)      | 3.2   | N/A        | Clear Space to XWalk (in)   | N/A   |
| N/A        | Any Obstructions?     | N/A   | N/A        | Storm Grate/Utility Hazard? | N/A   |
|            | Obstruction Type      |       |            | Storm Grate/Utility Type    |       |
|            |                       | N/A   |            |                             | N/A   |
|            |                       |       | Yes        | Surface Condition? (G/P)    | Good  |

Street 1 Name LINA ARDREY LN  
 Stop Condition-Street 2 None  
 Street 2 Name ALEXANDER MARTIN AV  
 Stop Condition-Street 1 StopSign

