


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 53349	Main Street: SAPPHIRE_HILL_LN	Cross Street: N/A	Location: SW
ADA ID: F4D9386EBFE1	Ramp Type: Perp	Initial Pass/Fail: Pass	Overall Compliance: No
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	
Severity Score: 5			

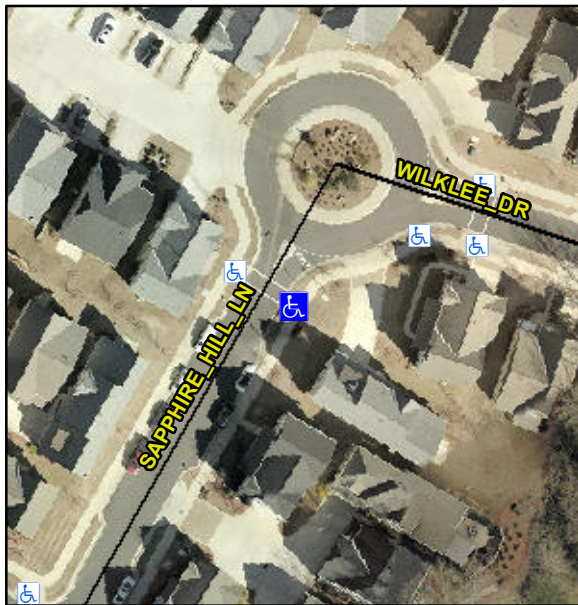

Possible Solutions:

**Remove & Replace Entire Ramp.
Gutter Ponding Observed.**

Surveyor Notes:

N/A

PROW/ADA:

**R304.2.2-Perp, R304.3.2-Para,
R304.5.3, R304.2.3, R302.7**

Total Cost: \$ 2350.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	59.5	Yes	Ramp Slope (%)	7.9
Yes	Ramp Width (in)	48.0	Yes	Ramp XSlope (%)	0.1
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	10.4	No	Flare Slope RT (%)	12.5
N/A	Flare Traversable LT?	Yes	N/A	Flare Traversable RT?	Yes
Yes	Landing Length (in)	71.5	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	48.0	Yes	DWS Contrast?	Yes
No	Landing Slope (%)	2.2	Yes	DWS Length (in)	24.0
No	Landing X Slope (%)	3.1	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	Yes	DWS Offset (in)	2.0
N/A	Shared Landing?	No			
No	Gutter Ponding?	Yes	Yes	Gutter Slope (%)	1.8
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	1.8
N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To NW		X Walk 2 Direction	N/A
N/A	X Walk 1 Width (in)	87.5	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	2.9		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	1.8		X Walk 2 X Slope (%)	N/A
Yes	Ramp inside XWalk1?	Yes	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	N/A	N/A	Clear Space?	Yes
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good

Street 1 Name **SAPPHIRE HILL LN**
 Stop Condition-Street 2 **YieldSign**
 Street 2 Name **N/A**
 Stop Condition-Street 1 **N/A**

