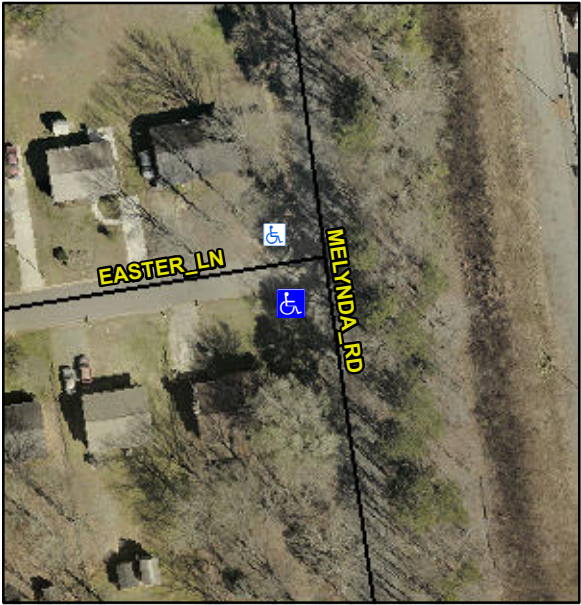


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 7023	Main Street: EASTER_LN	Cross Street: MELYNDA_RD	Location: S
ADA ID: F51807A72DB8	Ramp Type: Perp	Initial Pass/Fail: Fail	Overall Compliance: No
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	
Severity Score: 21.25			

	Possible Solutions:			
	Remove & Replace Entire Ramp.			
	Surveyor Notes:			
	N/A			
	PROW/ADA:			
	Not Found, R304.5.1, R304.2.2			
	Total Cost:	\$	1850.00	
	Street 1 Name	EASTER LN		
	Stop Condition-Street 2	StopSign		
	Street 2 Name	N/A		
	Stop Condition-Street 1	N/A		
		Compliance	Description	Data
		N/A	Ramp Length (in)	48.0
		No	Ramp Width (in)	47.5
		N/A	Flare Type LT	N/A
		N/A	Flare Slope LT (%)	N/A
		N/A	Flare Traversable LT?	N/A
		N/A	Landing Length (in)	N/A
		N/A	Landing Width (in)	N/A
		N/A	Landing Slope (%)	N/A
		N/A	Landing X Slope (%)	N/A
		N/A	Landing Curb? (Y/N)	N/A
		N/A	Shared Landing?	N/A
		N/A	Gutter Ponding?	Yes
		N/A	Gutter Lip Ht (in)	N/A
		N/A	Painted X Walk1?	No
			X Walk 1 Direction	To N
		N/A	X Walk 1 Width (in)	N/A
			X Walk 1 Slope (%)	1.2
			X Walk 1 X Slope (%)	0.7
		N/A	Ramp inside XWalk1?	N/A
			Road Slope (%)	N/A
			Road X Slope (%)	N/A
		N/A	Any Obstructions?	N/A
			Obstruction Type	
		N/A		N/A
		Yes	Surface Condition? (G/P)	Good

