

# Access Compliance Report


## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 5591	Main Street: CARVER_BV	Cross Street: HAWKINS_PL	Location: N
ADA ID: F545D303C83E	Ramp Type: Para	Initial Pass/Fail: Fail	Overall Compliance: No
			Severity Score: 31.25

#### Codes/Mitigation Info/Possible Solution

#### Field Measurements/Component Compliance

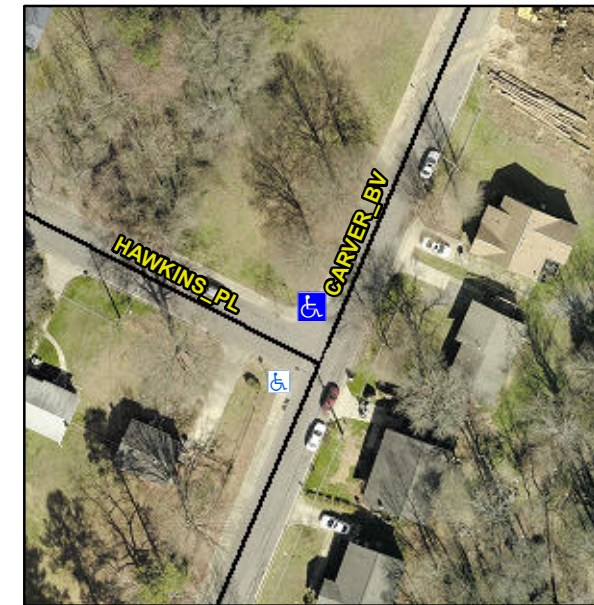

Possible Solutions:

**Remove & Replace Entire Ramp.**

Surveyor Notes:

**RT RP < 5%**

PROW/ADA:

**R304.5.1, R304.3.2, R304.5.3**

Total Cost: \$ 1600.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	72.0	N/A	Ramp Length RT (in)	60.0
No	Ramp Width LT (in)	36.0	No	Ramp Width RT (in)	35.5
No	Ramp Slope LT (%)	11.6	Yes	Ramp Slope RT (%)	3.4
No	Ramp XSlope LT (%)	2.8	Yes	Ramp XSlope RT (%)	1.8
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	N/A			
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To SW		X Walk 2 Direction	N/A
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	1.5		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	3.2		X Walk 2 X Slope (%)	N/A
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	N/A	N/A	Clear Space?	N/A
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	15.7

Street 1 Name	HAWKINS PL
Stop Condition-Street 1	StopSign
Street 2 Name	N/A
Stop Condition-Street 2	N/A

