

# Access Compliance Report


## Public Rights-of-Way

### (Curb Ramps)

|                        |                           |                         |                        |
|------------------------|---------------------------|-------------------------|------------------------|
| Intersection ID: 28011 | Main Street: CHANCELOT_LN | Cross Street: LEGACY_CR | Location: NE           |
| ADA ID: F58F7026C67F   | Ramp Type: Perp           | Initial Pass/Fail: Pass | Overall Compliance: No |
|                        |                           | Severity Score: 10      |                        |

#### Codes/Mitigation Info/Possible Solution

#### Field Measurements/Component Compliance

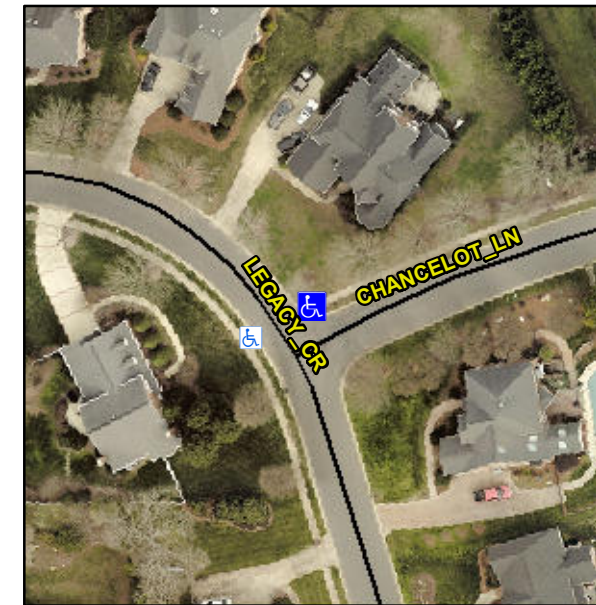

Possible Solutions:

**Remove & Replace Entire Ramp.  
Remove & Replace Gutter.**

Surveyor Notes:

**N/A**

PROW/ADA:

**Not Found, R304.2.1, R304.2.2-Perp,  
R304.3.2-Para, R304.5.3**

Total Cost: \$ 2600.00

| Compliance | Description           | Data   | Compliance | Description                 | Data |
|------------|-----------------------|--------|------------|-----------------------------|------|
| N/A        | Ramp Length (in)      | 86.0   | Yes        | Ramp Slope (%)              | 5.8  |
| Yes        | Ramp Width (in)       | 48.0   | Yes        | Ramp XSlope (%)             | 0.8  |
| N/A        | Flare Type LT         | Sloped | N/A        | Flare Type RT               | N/A  |
| N/A        | Flare Slope LT (%)    | 6.5    | Yes        | Flare Slope RT (%)          | 0.2  |
| N/A        | Flare Traversable LT? | No     | N/A        | Flare Traversable RT?       | Yes  |
| No         | Landing Length (in)   | N/A    | Yes        | DWS Provided?               | Yes  |
| No         | Landing Width (in)    | N/A    | Yes        | DWS Contrast?               | Yes  |
| No         | Landing Slope (%)     | N/A    | Yes        | DWS Length (in)             | 24.0 |
| No         | Landing X Slope (%)   | N/A    | Yes        | DWS Full Width?             | Yes  |
| N/A        | Landing Curb? (Y/N)   | No     | Yes        | DWS Offset (in)             | 2.0  |
| N/A        | Shared Landing?       | No     |            |                             |      |
| Yes        | Gutter Ponding?       | No     | Yes        | Gutter Slope (%)            | 4.0  |
| Yes        | Gutter Lip Ht (in)    | 0.0    | No         | Gutter X Slope (%)          | 2.3  |
| N/A        | Painted X Walk1?      | No     | N/A        | Painted X Walk2?            | N/A  |
|            | X Walk 1 Direction    | To SW  |            | X Walk 2 Direction          | N/A  |
| N/A        | X Walk 1 Width (in)   | N/A    | N/A        | X Walk 2 Width (in)         | N/A  |
|            | X Walk 1 Slope (%)    | 1.0    |            | X Walk 2 Slope (%)          | N/A  |
|            | X Walk 1 X Slope (%)  | 0.9    |            | X Walk 2 X Slope (%)        | N/A  |
| N/A        | Ramp inside XWalk1?   | N/A    | N/A        | Ramp inside XWalk2?         | N/A  |
|            | Road Slope (%)        | N/A    | N/A        | Clear Space?                | Yes  |
|            | Road X Slope (%)      | N/A    | N/A        | Clear Space to XWalk (in)   | N/A  |
| Yes        | Any Obstructions?     | No     | Yes        | Storm Grate/Utility Hazard? | No   |
|            | Obstruction Type      |        |            | Storm Grate/Utility Type    |      |
|            |                       | N/A    |            |                             | N/A  |
|            |                       |        | Yes        | Surface Condition? (G/P)    | Good |

|                         |           |
|-------------------------|-----------|
| Street 1 Name           | LEGACY CR |
| Stop Condition-Street 2 | None      |
| Street 2 Name           | N/A       |
| Stop Condition-Street 1 | N/A       |

