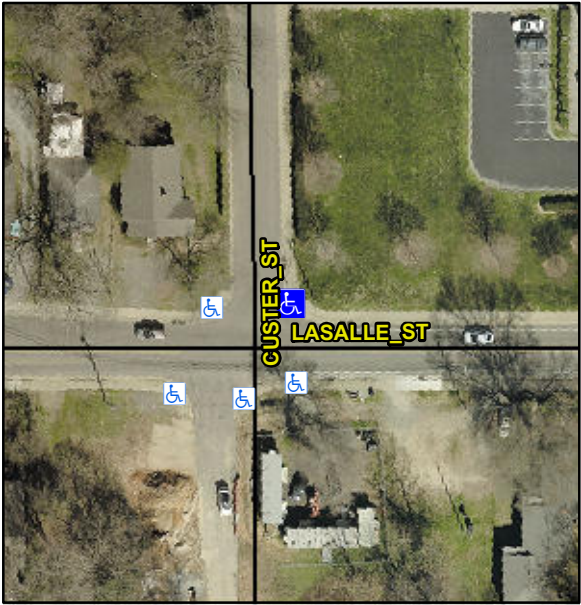


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 8350	Main Street: LASALLE_ST	Cross Street: CUSTER_ST	Location: NE
ADA ID: F599C3C370D2	Ramp Type: PerpDiag	Initial Pass/Fail: Fail	Overall Compliance: No
		Severity Score: 35	

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance		
	Possible Solutions:		Compliance	Description	Data
	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.		No	Ramp Length (in)	59.5
			No	Ramp Width (in)	39.0
			N/A	Flare Type LT	N/A
			N/A	Flare Slope LT (%)	N/A
			N/A	Flare Traversable LT?	N/A
			N/A	Landing Length (in)	N/A
			N/A	Landing Width (in)	N/A
			N/A	Landing Slope (%)	N/A
			N/A	Landing X Slope (%)	N/A
			N/A	Landing Curb? (Y/N)	N/A
			N/A	Shared Landing?	N/A
			N/A	Gutter Ponding?	N/A
			N/A	Gutter Lip Ht (in)	N/A
			N/A	Painted X Walk1?	No
				X Walk 1 Direction	To W
			N/A	X Walk 1 Width (in)	N/A
				X Walk 1 Slope (%)	1.6
				X Walk 1 X Slope (%)	3.7
			N/A	Ramp inside XWalk1?	N/A
<p>Surveyor Notes:</p> <p>N/A</p> <p>PROW/ADA:</p> <p>Not Found, R304.5.1, R304.2.2, R304.5.3</p>			N/A	Ramp inside XWalk2?	N/A
				Road Slope (%)	1.6
				Road X Slope (%)	0.7
			N/A	Any Obstructions?	N/A
				Obstruction Type	
			N/A		N/A
			Yes	Surface Condition? (G/P)	Good

Street 1 Name	CUSTER ST
Stop Condition-Street 2	StopSign
Street 2 Name	LASALLE ST
Stop Condition-Street 1	None

Total Cost: \$ 3200.00

