

Access Compliance Report Public Rights-of-Way (Curb Ramps)



Data

51.0

50.0

8.9

4.3

8.6

11.4

N/A

No

N/A

2.3

9.9

N/A

N/A

N/A

N/A

N/A

N/A

N/A

Good 1.5

To NE

Intersection ID: N/A Main Street: NATIONS FORD RD Cross Street: FORSYTH HALL DR W Location: **Overall Compliance: No Severity Score:** 0 **ADA ID: F5D5EF9A4590** Ramp Type: Combination1Diag Initial Pass/Fail: Fail

3200.00

N/A

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

N/A

Yes

No

No

Nο

No

N/A

Compliance Description

Ramp Length RT (in)

Ramp Width RT (in)

Ramp Slope RT (%)

Ramp XSlope RT (%)

Ramp Slope (%)

Flare Type RT

Ramp XSlope (%)

Flare Slope RT (%)

DWS Provided?

DWS Contrast?

DWS Length (in)

DWS Full Width?

DWS Offset (in)

Gutter Slope (%)

Gutter X Slope (%)

Painted X Walk2?

X Walk 2 Direction

X Walk 2 Width (in)

X Walk 2 Slope (%)

X Walk 2 X Slope (%)

Ramp inside XWalk2?

Clear Space?

Flare Traversable RT?

Data

59.0

47.0

12.6

0.3

60.0

48.0

N/A

No

N/A

7.1

2.8

N/A

8.5

To SE




Street 1 Name Stop Condition-Street 1 Street 2 Name Stop Condition-Street 2

None NATIONS FORD RD StopSign FORSYTH HALL DR Possible Solutions: Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Surveyor Notes: N/A PROW/ADA: R304.5.1, R304.2.2, R304.5.3, R304.3.2

Total Cost:

Compliance Description N/A Ramp Length LT (in) No Ramp Width LT (in) No Ramp Slope LT (%) Ramp XSlope LT (%) Yes N/A Ramp Length (in) Yes Ramp Width (in) N/A Flare Type LT N/A Flare Slope LT (%) N/A Flare Traversable LT? N/A Landing Length (in) N/A Landing Width (in) N/A Landing Slope (%) N/A Landing X Slope (%) N/A Landing Curb? (Y/N) N/A Shared Landing? N/A **Gutter Ponding?** N/A Gutter Lip Ht (in) Painted X Walk1? N/A X Walk 1 Direction X Walk 1 Width (in) X Walk 1 Slope (%)



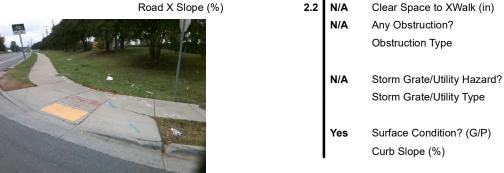

X Walk 1 X Slope (%)

Ramp inside XWalk1?

Road Slope (%)



