

Access Compliance Report


Public Rights-of-Way

(Curb Ramps)

Intersection ID: 14078	Main Street: EAST_BV	Cross Street: SOUTH_BV	Location: NW
ADA ID: F62BB29001EC	Ramp Type: BlendTrans2	Initial Pass/Fail: Pass	Overall Compliance: No
			Severity Score: 10.25

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

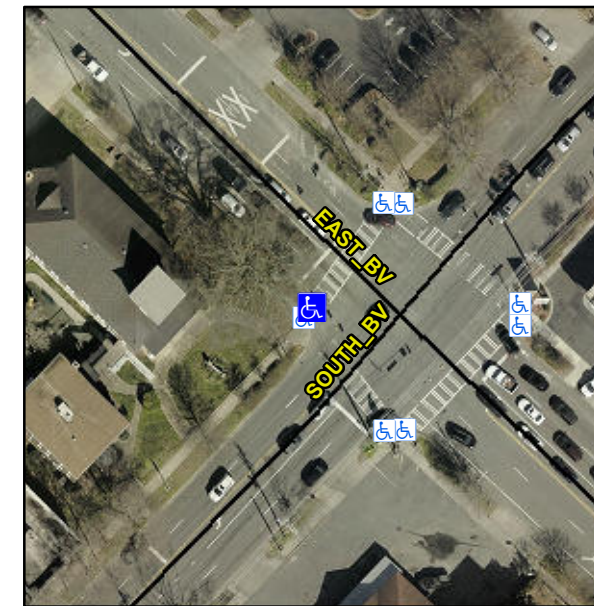

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

N/A

PROW/ADA:

Not Found, R304.2.3, R305

Total Cost: \$ 3200.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	41.0	Yes	BlendTrans Slope (%)	3.7
Yes	Ramp Width (in)	48.0	Yes	BlendTrans XSlope (%)	2.1
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	Sloped
No	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	Yes	N/A	Flare Traversable RT?	No
N/A	Landing Length (in)	N/A	No	DWS Provided?	No
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	No
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	Yes	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	2.8
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	2.2
N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To NE		X Walk 2 Direction	N/A
	X Walk 1 Width (in)	116.0		X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	3.3		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	4.8		X Walk 2 X Slope (%)	N/A
Yes	Ramp inside XWalk1?	Yes	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	4.8		Clear Space?	Yes
	Road X Slope (%)	3.3	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			No	Curb Slope (%)	12.6

Street 1 Name	EAST BV
Stop Condition-Street 1	Signal
Street 2 Name	N/A
Stop Condition-Street 2	N/A

