


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 49655	Main Street: GREENWAY_CRESCENT_LN	Cross Street: SEIGLE_POINT_DR	Location:	N
ADA ID: F63CCB67E2AB	Ramp Type: Directional1	Initial Pass/Fail: Pass	Overall Compliance: No	Severity Score: 7.5
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance		

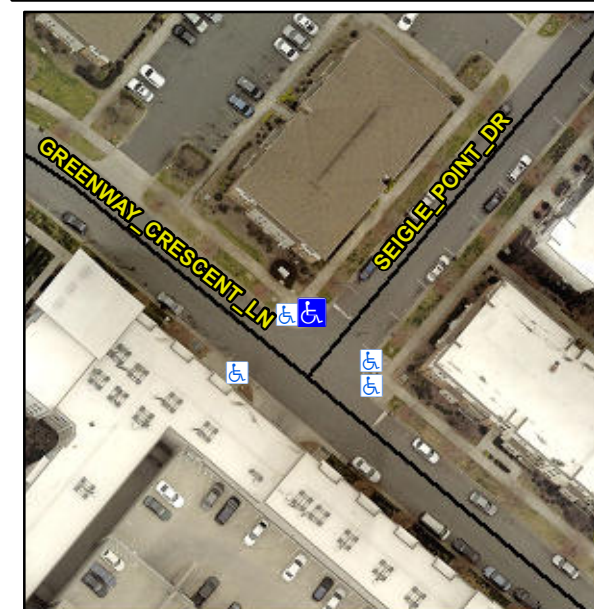

Possible Solutions:

**Remove & Replace Entire Ramp.
Grind Gutter Lip.**

Surveyor Notes:

N/A

PROW/ADA:

R304.5.3, R302.7, R302.7.2

Total Cost: \$ 1800.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	82.0	Yes	Grade Break?	Yes
Yes	Ramp Width (in)	73.0	No	Grade Break Slope (%)	5.7
Yes	Ramp Slope (%)	7.2	Yes	Grade Break XSlope (%)	0.5
Yes	Ramp XSlope (%)	0.4			
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	2.9
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	No
Yes	Landing Length (in)	68.5	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	69.5	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	0.1	Yes	DWS Length (in)	24.5
Yes	Landing X Slope (%)	1.0	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	N/A	Yes	DWS Offset LT (in)	1.5
N/A	Shared Landing?	Yes	Yes	DWS Offset RT (in)	13.0
No	Gutter Ponding?	Yes	Yes	Gutter Slope (%)	3.8
No	Gutter Lip Ht (in)	0.3	Yes	Gutter X Slope (%)	0.9
N/A	Painted X Walk1?	No		Road Slope (%)	5.5
	X Walk 1 Direction	To SE		Road X Slope (%)	2.2
	X Walk 1 Width (in)	N/A		Clear Space?	Yes
	X Walk 1 Slope (%)	5.5	N/A	Clear Space to XWalk (in)	N/A
	X Walk 1 X Slope (%)	2.2	Yes	Storm Grate/Utility Hazard?	No
N/A	Ramp inside XWalk1?	N/A		Storm Grate/Utility Type	
Yes	Any Obstructions?	No			N/A
	Obstruction Type		Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	8.3

