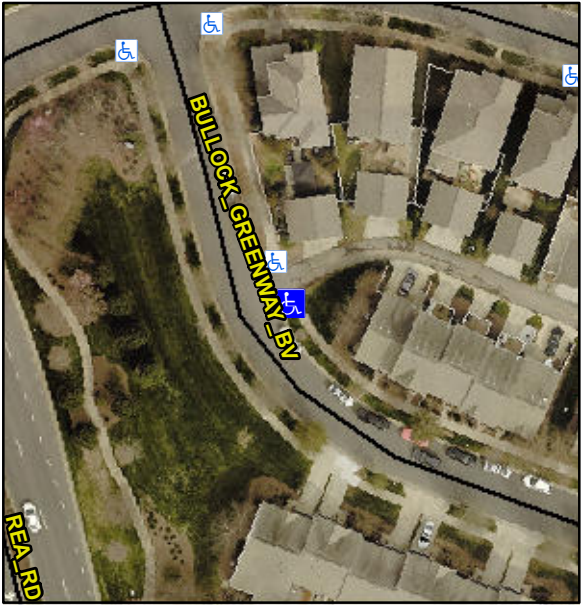


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 10022119	Main Street: BULLOCK_GREENWAY_BV	Cross Street: N/A	Location: SE
ADA ID: F674EEFB6AAB	Ramp Type: PerpDiag	Initial Pass/Fail: Pass	Overall Compliance: No
			Severity Score: 10.25

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance			
	Possible Solutions:		Compliance	Description	Data	
	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.		N/A	Ramp Length (in)	54.0	Yes
			Yes	Ramp Width (in)	60.0	No
			N/A	Flare Type LT	None	N/A
			N/A	Flare Slope LT (%)	N/A	N/A
			N/A	Flare Traversable LT?	N/A	N/A
			Yes	Landing Length (in)	61.0	No
			Yes	Landing Width (in)	59.0	N/A
			Yes	Landing Slope (%)	1.7	N/A
			Yes	Landing X Slope (%)	0.0	N/A
			N/A	Landing Curb? (Y/N)	No	N/A
			N/A	Shared Landing?	No	
			Yes	Gutter Ponding?	No	Yes
			Yes	Gutter Lip Ht (in)	0.0	Yes
			N/A	Painted X Walk1?	No	N/A
				X Walk 1 Direction	To N	
			N/A	X Walk 1 Width (in)	N/A	N/A
				X Walk 1 Slope (%)	1.3	
				X Walk 1 X Slope (%)	0.1	
			N/A	Ramp inside XWalk1?	N/A	N/A
<p>Surveyor Notes:</p> <p>N/A</p> <p>PROW/ADA:</p> <p>R304.5.3, R305</p>			Compliance	Description	Data	
			N/A	Flare Type RT	N/A	N/A
			N/A	Flare Slope RT (%)	N/A	8.1
			N/A	Flare Traversable RT?	N/A	No
			No	DWS Provided?		No
			N/A	DWS Contrast?		No
			N/A	DWS Length (in)		N/A
			N/A	DWS Full Width?		No
			N/A	DWS Offset (in)		N/A
			Yes	Gutter Slope (%)		0.1
			Yes	Gutter X Slope (%)		1.2
			N/A	Painted X Walk2?		No
				X Walk 2 Direction	To W	
			N/A	X Walk 2 Width (in)		N/A
				X Walk 2 Slope (%)		2.2
				X Walk 2 X Slope (%)		1.8
			N/A	Ramp inside XWalk2?		N/A
			N/A	Clear Space?		Yes
			N/A	Clear Space to XWalk (in)		N/A
			Yes	Storm Grate/Utility Hazard?		No
<p>Total Cost:</p> <p>\$ 3200.00</p>				Obstruction Type		
			N/A			N/A
			Yes	Surface Condition? (G/P)		Good

