


Intersection ID: 9530	Main Street: MCBRIDE_ST	Cross Street: THE_PLAZA	Location:	S
ADA ID: F81EFDC909C8	Ramp Type: PerpDiag	Initial Pass/Fail: Pass	Overall Compliance: No	Severity Score: 27.75

Codes/Mitigation Info/Possible Solution	Field Measurements/Component Compliance
---	---

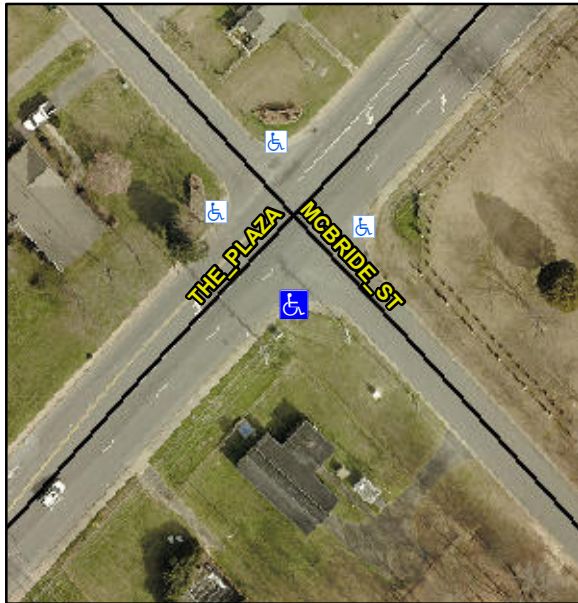

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter.

Surveyor Notes:

N/A

PROW/ADA:

Not Found, R304.5.3, R304.2.1,
R304.2.2-Perp, R304.3.2-Para,
R304.2.3, R305.1.4, R305.2, R302.7,

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	60.5	Yes	Ramp Slope (%)	7.8
Yes	Ramp Width (in)	54.0	No	Ramp XSlope (%)	4.9
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	11.3	Yes	Flare Slope RT (%)	6.5
N/A	Flare Traversable LT?	Yes	N/A	Flare Traversable RT?	Yes
No	Landing Length (in)	N/A	Yes	DWS Provided?	Yes
No	Landing Width (in)	N/A	Yes	DWS Contrast?	Yes
No	Landing Slope (%)	N/A	Yes	DWS Length (in)	24.0
No	Landing X Slope (%)	N/A	No	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	No	No	DWS Offset (in)	5.0
N/A	Shared Landing?	N/A			
No	Gutter Ponding?	Yes	No	Gutter Slope (%)	7.4
No	Gutter Lip Ht (in)	0.5	Yes	Gutter X Slope (%)	1.9
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To NE		X Walk 2 Direction	To NW
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	2.3		X Walk 2 Slope (%)	1.5
	X Walk 1 X Slope (%)	0.1		X Walk 2 X Slope (%)	2.4
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	1.5	N/A	Clear Space?	Yes
	Road X Slope (%)	2.8	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good

Total Cost: \$ 3950.00

