


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 9610	Main Street: BARRINGTON_DR	Cross Street: THE_PLAZA	Location: SE
ADA ID: F85677DA9287	Ramp Type: ParaDiag	Initial Pass/Fail: Pass	Overall Compliance: No
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	
Severity Score: 7.75			

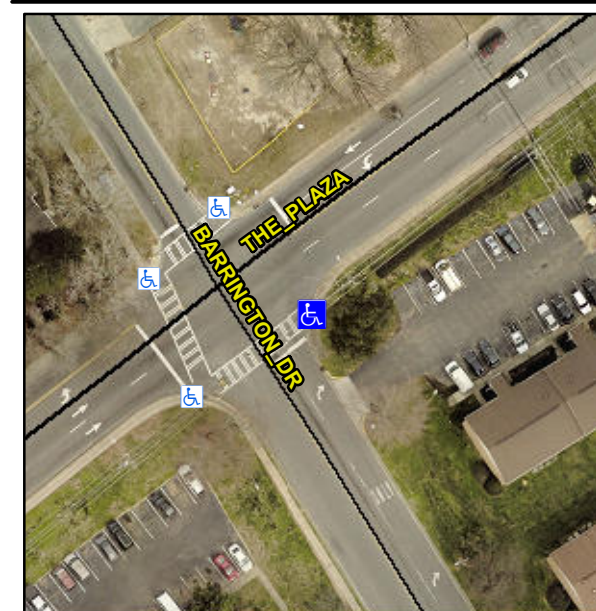

Possible Solutions:

**Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Grind Gutter Lip.**

Surveyor Notes:

**N/A**

PROW/ADA:

**R304.5.3, R304.2.1, R304.2.2-Perp, R304.3.2-Para, R305.2, R302.7, R302.7.2**

Total Cost: \$ 3400.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	48.0	N/A	Ramp Length RT (in)	37.0
Yes	Ramp Width LT (in)	60.0	Yes	Ramp Width RT (in)	58.0
Yes	Ramp Slope LT (%)	5.6	Yes	Ramp Slope RT (%)	6.2
Yes	Ramp XSlope LT (%)	0.2	No	Ramp XSlope RT (%)	2.8
Yes	Landing Length (in)	60.0	Yes	DWS Provided?	Yes
No	Landing Width (in)	34.0	Yes	DWS Contrast?	Yes
No	Landing Slope (%)	4.5	Yes	DWS Length (in)	25.5
No	Landing X Slope (%)	2.7	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	No	DWS Offset (in)	4.0
N/A	Shared Landing?	No			
No	Gutter Ponding?	Yes	Yes	Gutter Slope (%)	4.1
No	Gutter Lip Ht (in)	0.5	Yes	Gutter X Slope (%)	2.0
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	Yes
	X Walk 1 Direction	To NW		X Walk 2 Direction	To SW
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	106.0
	X Walk 1 Slope (%)	1.5		X Walk 2 Slope (%)	2.0
	X Walk 1 X Slope (%)	2.5		X Walk 2 X Slope (%)	0.2
N/A	Ramp inside XWalk1?	N/A	Yes	Ramp inside XWalk2?	Yes
	Road Slope (%)	0.7	N/A	Clear Space?	Yes
	Road X Slope (%)	1.8	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	9.4

