


Access Compliance Report

Public Rights-of-Way (Curb Ramps)

Intersection ID: 14547	Main Street: EAST_BV	Cross Street: SPRINGDALE_AV	Location: SW
ADA ID: F8FF2EBB9DE6	Ramp Type: BlendTrans1	Initial Pass/Fail: Pass	Overall Compliance: No
		Severity Score: 0	

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

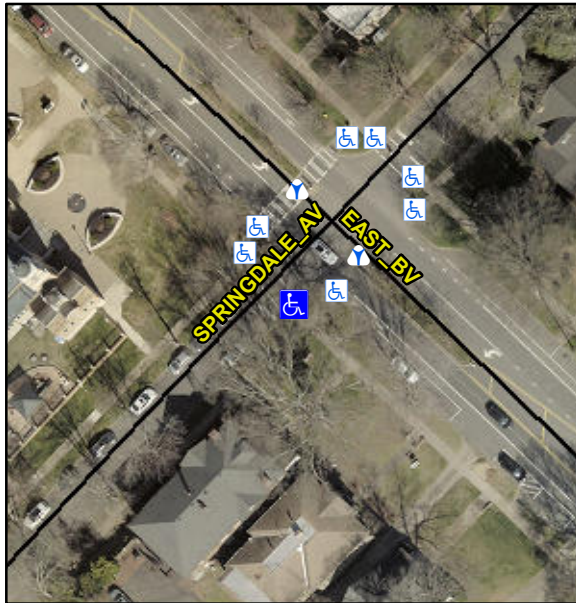

Possible Solutions:

Remove & Replace Detectable Warning System. Remove & Replace Gutter.

Surveyor Notes:

N/A

PROW/ADA:

R305.2, R304.5.3

Street 1 Name	SPRINGDALE AV
Stop Condition-Street 1	StopSign
Street 2 Name	N/A
Stop Condition-Street 2	N/A

Total Cost: \$ **1550.00**

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	86.0	Yes	BlendTrans Slope (%)	3.5
Yes	Ramp Width (in)	72.0	Yes	BlendTrans XSlope (%)	0.9
Yes	Flare Type L	Curbed_NoWalkSurface	Yes	Flare Type R	Curbed_NoWalkSurface
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
Yes	Landing Length (in)	48.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	72.0	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	1.6	Yes	DWS Length (in)	24.0
Yes	Landing X Slope (%)	0.9	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	No	DWS Offset (in)	6.0
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	5.0
Yes	Gutter Lip Ht (in)	0.0	No	Gutter X Slope (%)	3.4
N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To NW		X Walk 2 Direction	N/A
	X Walk 1 Width (in)	112.0		X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	5.4		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	3.6		X Walk 2 X Slope (%)	N/A
Yes	Ramp inside XWalk1?	Yes	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	3.6		Clear Space?	Yes
	Road X Slope (%)	5.4	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			Yes	Curb Slope (%)	3.3

