


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 28322	Main Street: ARDREY_KELL_RD	Cross Street: BEAU_RILEY_RD	Location: NE
ADA ID: F9A177BCFBC1	Ramp Type: PerpDiag	Initial Pass/Fail: Pass	Overall Compliance: No
Codes/Mitigation Info/Possible Solution			Severity Score: 15
			Field Measurements/Component Compliance

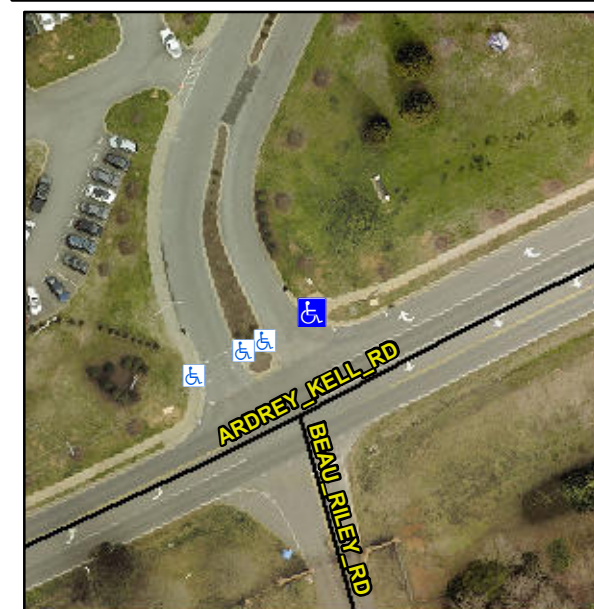

Possible Solutions:

Remove & Replace Landing. Grind Gutter Lip.

Surveyor Notes:

N/A

PROW/ADA:

R304.2.2-Perp, R304.3.2-Para, R302.7.2

Total Cost: \$ 700.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	71.0	Yes	Ramp Slope (%)	6.5
Yes	Ramp Width (in)	60.0	Yes	Ramp XSlope (%)	1.2
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	6.5	Yes	Flare Slope RT (%)	4.8
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	Yes
Yes	Landing Length (in)	60.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	60.0	Yes	DWS Contrast?	Yes
No	Landing Slope (%)	2.3	Yes	DWS Length (in)	25.5
Yes	Landing X Slope (%)	1.4	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	Yes	DWS Offset (in)	1.5
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	1.8
No	Gutter Lip Ht (in)	1.0	Yes	Gutter X Slope (%)	1.0
N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To W		X Walk 2 Direction	To SE
N/A	X Walk 1 Width (in)	52.0	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	2.2		X Walk 2 Slope (%)	2.5
	X Walk 1 X Slope (%)	3.5		X Walk 2 X Slope (%)	3.8
Yes	Ramp inside XWalk1?	Yes	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	1.2	N/A	Clear Space?	Yes
	Road X Slope (%)	4.4	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good

