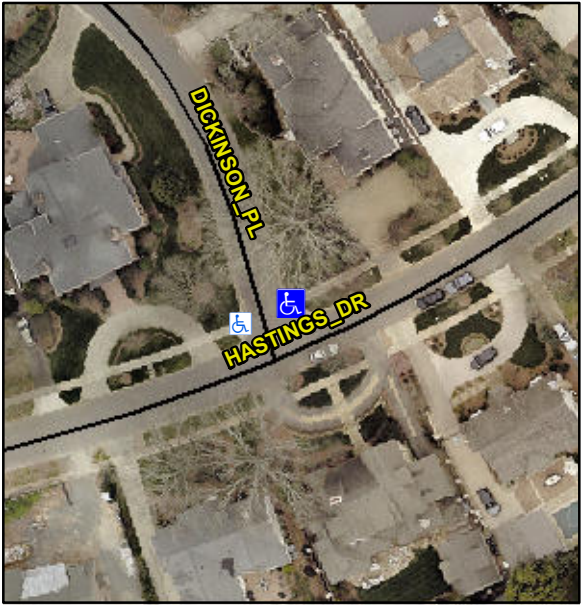


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 16844	Main Street: DICKINSON_PL	Cross Street: HASTINGS_DR	Location: NE
ADA ID: FAEA5A543992	Ramp Type: Perp	Initial Pass/Fail: Fail	Overall Compliance: No
			Severity Score: 26.25

Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance					
 <p>Street 1 Name DICKINSON PL</p> <p>Stop Condition-Street 2 StopSign</p> <p>Street 2 Name N/A</p> <p>Stop Condition-Street 1 N/A</p>	Possible Solutions:	Remove & Replace Entire Ramp.					
	Surveyor Notes:	N/A					
	PROW/ADA:	Not Found, R304.5.3					
			Compliance	Description	Data	Compliance	Description
			N/A	Ramp Length (in)	232.0	Yes	Ramp Slope (%)
			Yes	Ramp Width (in)	53.5	No	Ramp XSlope (%)
			N/A	Flare Type LT	N/A	N/A	Flare Type RT
			N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)
			N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?
			N/A	Landing Length (in)	N/A	N/A	DWS Provided?
			N/A	Landing Width (in)	N/A	N/A	DWS Contrast?
			N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)
			N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?
			N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)
			N/A	Shared Landing?	N/A		
			N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)
			N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)
			N/A	Painted X Walk1?	No	N/A	Painted X Walk2?
				X Walk 1 Direction	To W		X Walk 2 Direction
			N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)
				X Walk 1 Slope (%)	4.4		X Walk 2 Slope (%)
				X Walk 1 X Slope (%)	7.2		X Walk 2 X Slope (%)
			N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?
				Road Slope (%)	N/A	N/A	Clear Space?
				Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)
			N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?
				Obstruction Type			Storm Grate/Utility Type
					N/A		N/A
						Yes	Surface Condition? (G/P)
							Good

Total Cost: \$ 1850.00

