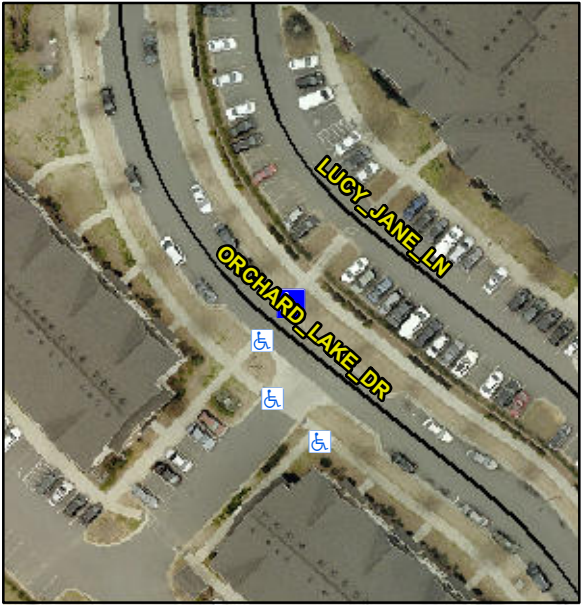


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 10033675	Main Street: ORCHARD_LAKE_DR	Cross Street: N/A	Location: NE
ADA ID: FB04C2ECA282	Ramp Type: Perp	Initial Pass/Fail: Pass	Overall Compliance: No
		Severity Score: 17.5	

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance		
	Possible Solutions:		Compliance	Description	Data
	Remove & Replace Entire Ramp.		Yes	Ramp Length (in)	169.0
			Yes	Ramp Width (in)	71.5
			N/A	Flare Type LT	Sloped
			N/A	Flare Slope LT (%)	0.1
			N/A	Flare Traversable LT?	No
			Yes	Landing Length (in)	71.0
			Yes	Landing Width (in)	72.0
			Yes	Landing Slope (%)	0.1
			Yes	Landing X Slope (%)	0.9
<p>Surveyor Notes:</p> <p>N/A</p> <p>PROW/ADA:</p> <p>Not Found, R305.1.4, R302.7.2</p>			N/A	Flare Type RT	N/A
			N/A	Flare Slope RT (%)	6.9
			N/A	Flare Traversable RT?	No
			Yes	DWS Provided?	Yes
			Yes	DWS Contrast?	Yes
			Yes	DWS Length (in)	24.0
			No	DWS Full Width?	No
			Yes	DWS Offset (in)	1.0
			No	Gutter Ponding?	No
			No	Gutter Lip Ht (in)	1.0
			N/A	Painted X Walk1?	No
				X Walk 1 Direction	To SW
			N/A	X Walk 1 Width (in)	N/A
				X Walk 1 Slope (%)	1.2
				X Walk 1 X Slope (%)	0.3
			N/A	Ramp inside XWalk1?	N/A
			N/A	Road Slope (%)	N/A
			N/A	Road X Slope (%)	N/A
			Yes	Any Obstructions?	No
				Obstruction Type	
Total Cost: \$ 1850.00			N/A	Storm Grate/Utility Hazard?	No
				Storm Grate/Utility Type	
			N/A		N/A
			Yes	Surface Condition? (G/P)	Good

Street 1 Name	ORCHARD LAKE DR
Stop Condition-Street 2	None
Street 2 Name	N/A
Stop Condition-Street 1	N/A

