


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 51470		Main Street: HUCKS_LANDING_DR		Cross Street: HUCKS_RD		Location:		W									
ADA ID: FB2FB1340D0B		Ramp Type: Directional1		Initial Pass/Fail: Pass		Overall Compliance: No		Severity Score: 5									
Codes/Mitigation Info/Possible Solution				Field Measurements/Component Compliance													
<div></div> <div>Street 1 NameHUCKS LANDING DR</div> <div>Stop Condition-Street 1None</div> <div>Street 2 NameN/A</div> <div>Stop Condition-Street 2N/A</div>				Possible Solutions:		Compliance		Description		Data		Compliance		Description		Data	
				Remove & Replace Entire Ramp. Remove & Replace Gutter.		N/A		Ramp Length (in)		158.0		No		Grade Break?		No	
						Yes		Ramp Width (in)		60.0		N/A		Grade Break Slope (%)		7.8	
						Yes		Ramp Slope (%)		6.1		N/A		Grade Break XSlope (%)		3.4	
						Yes		Ramp XSlope (%)		2.0							
						N/A		Flare Type LT		N/A		N/A		Flare Type RT		N/A	
						N/A		Flare Slope LT (%)		N/A		N/A		Flare Slope RT (%)		N/A	
						N/A		Flare Traversable LT?		N/A		N/A		Flare Traversable RT?		N/A	
						Yes		Landing Length (in)		60.5		Yes		DWS Provided?		Yes	
						Yes		Landing Width (in)		59.0		Yes		DWS Contrast?		Yes	
		No		Landing Slope (%)		5.5		Yes		DWS Length (in)		24.0					
		Yes		Landing X Slope (%)		3.0		Yes		DWS Full Width?		Yes					
		N/A		Landing Curb? (Y/N)		N/A		Yes		DWS Offset LT (in)		35.0					
		N/A		Shared Landing?		No		Yes		DWS Offset RT (in)		1.0					
		Yes		Gutter Ponding?		No		No		Gutter Slope (%)		6.8					
		Yes		Gutter Lip Ht (in)		0.0		Yes		Gutter X Slope (%)		3.9					
		N/A		Painted X Walk1?		No				Road Slope (%)		0.8					
				X Walk 1 Direction		To SE				Road X Slope (%)		3.9					
				X Walk 1 Width (in)		N/A				Clear Space?		Yes					
				X Walk 1 Slope (%)		0.8		N/A		Clear Space to XWalk (in)		N/A					
				X Walk 1 X Slope (%)		3.9		Yes		Storm Grate/Utility Hazard?		No					
		N/A		Ramp inside XWalk1?		N/A				Storm Grate/Utility Type							
		Yes		Any Obstructions?		No						N/A					
				Obstruction Type				Yes		Surface Condition? (G/P)		Good					
								N/A		No		Curb Slope (%)		12.6			
		Total Cost:		\$		2350.00											

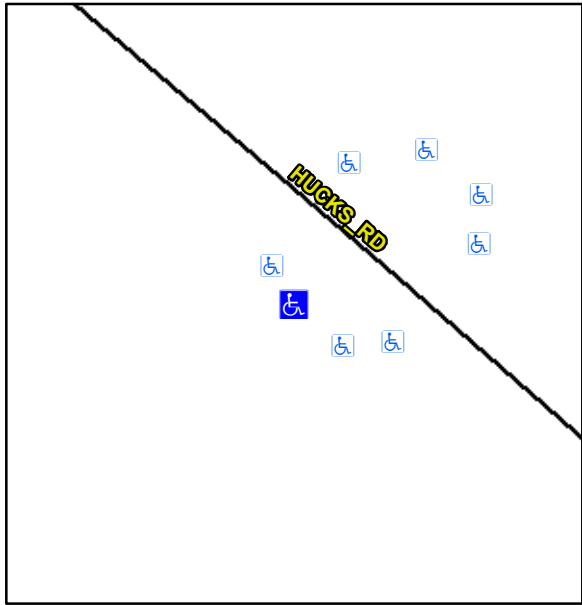