

Access Compliance Report


Public Rights-of-Way

(Curb Ramps)

Intersection ID: 51371	Main Street: UNIVERSITY_POINTE_BV	Cross Street: N_TRYON_ST	Location:	N
ADA ID: FB4AF6923D29	Ramp Type: BlendTrans2	Initial Pass/Fail: Pass	Overall Compliance: No	Severity Score: 5

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

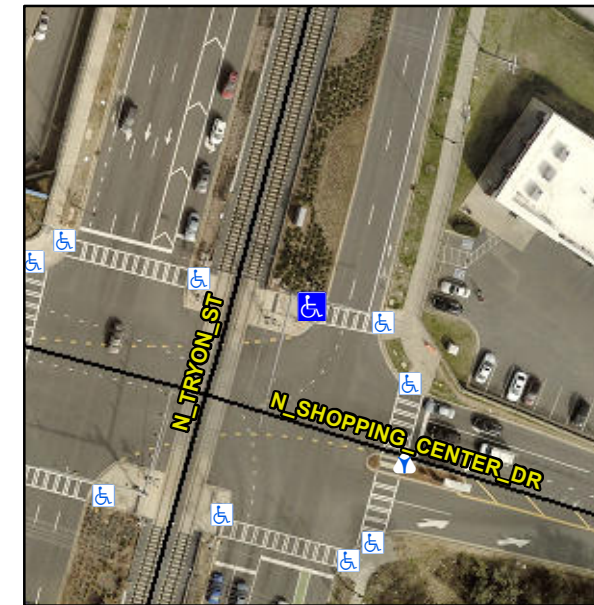

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

N/A

PROW/ADA:

R304.2.3, R305.2

Total Cost: \$ 3200.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	85.0	Yes	BlendTrans Slope (%)	2.5
Yes	Ramp Width (in)	120.0	Yes	BlendTrans XSlope (%)	0.9
No	Flare Type	Curbed_WithWalkSurface	Yes	Flare Type	Curbed_NoWalkSurface
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
N/A	Landing Length (in)	N/A	Yes	DWS Provided?	Yes
N/A	Landing Width (in)	N/A	Yes	DWS Contrast?	Yes
N/A	Landing Slope (%)	N/A	Yes	DWS Length (in)	24.5
N/A	Landing X Slope (%)	N/A	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	No	DWS Offset (in)	3.0
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	3.8
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	1.5
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To E		X Walk 2 Direction	N/A
	X Walk 1 Width (in)	N/A		X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	2.5		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	0.2		X Walk 2 X Slope (%)	N/A
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	0.2		Clear Space?	Yes
	Road X Slope (%)	2.5	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
			N/A		N/A
			Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	N/A

Street 1 Name N TRYON ST
 Stop Condition-Street 1 Signal
 Street 2 Name N/A
 Stop Condition-Street 2 N/A

