


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 10040584		Main Street: W_ARROWWOOD_RD		Cross Street: N/A		Location:		NE	
ADA ID: FB51AE51C898		Ramp Type: Directional1		Initial Pass/Fail: Fail		Overall Compliance: No		Severity Score: 13.75	
Codes/Mitigation Info/Possible Solution				Field Measurements/Component Compliance					
 Street 1 NameW ARROWOOD RD Stop Condition-Street 1None Street 2 NameN/A Stop Condition-Street 2StopSign Possible Solutions: Remove & Replace Entire Ramp. Surveyor Notes: N/A PROW/ADA: R304.2.2, R304.5.3 Total Cost:\$ 1600.00				Compliance	Description	Data	Compliance	Description	Data
				N/A	Ramp Length (in)	60.0	N/A	Grade Break?	N/A
				Yes	Ramp Width (in)	52.0	N/A	Grade Break Slope (%)	0.0
				No	Ramp Slope (%)	9.0	N/A	Grade Break XSlope (%)	0.0
				No	Ramp XSlope (%)	2.9			
				N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
				N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	0.0
				N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
				N/A	Landing Length (in)	0.0	N/A	DWS Provided?	N/A
				N/A	Landing Width (in)	0.0	N/A	DWS Contrast?	N/A
				N/A	Landing Slope (%)	0.0	N/A	DWS Length (in)	N/A
				N/A	Landing X Slope (%)	0.0	N/A	DWS Full Width?	N/A
				N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset LT (in)	N/A
				N/A	Shared Landing?	N/A	N/A	DWS Offset RT (in)	N/A
				N/A	Gutter Ponding?	0.0	N/A	Gutter Slope (%)	N/A
				N/A	Gutter Lip Ht (in)	0.0	N/A	Gutter X Slope (%)	N/A
				N/A	Painted X Walk1?	No		Road Slope (%)	0.5
					X Walk 1 Direction	To W		Road X Slope (%)	0.5
					X Walk 1 Width (in)	N/A		Clear Space?	N/A
					X Walk 1 Slope (%)	0.5	N/A	Clear Space to XWalk (in)	N/A
					X Walk 1 X Slope (%)	0.5	N/A	Storm Grate/Utility Hazard?	N/A
				N/A	Ramp inside XWalk1?	N/A		Storm Grate/Utility Type	
				N/A	Any Obstructions?	N/A			N/A
					Obstruction Type		Yes	Surface Condition? (G/P)	Good
							N/A	Curb Slope (%)	13.2

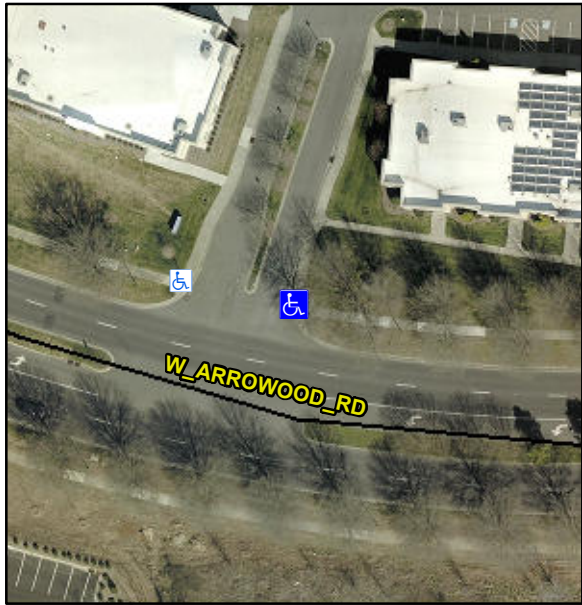