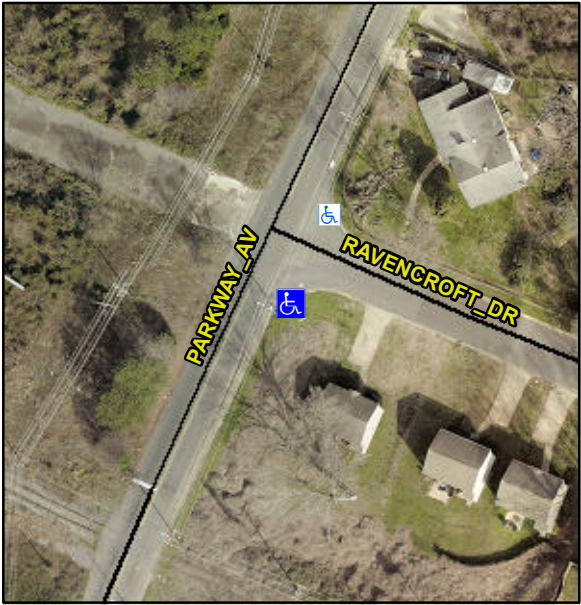


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 9954	Main Street: PARKWAY_AV	Cross Street: N/A	Location:	S
ADA ID: FB6636B71B7	Ramp Type: Directional1	Initial Pass/Fail: Fail	Overall Compliance: No	Severity Score: 35

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance			
	Possible Solutions:		<b>Compliance</b>	<b>Description</b>	<b>Data</b>	
	Remove & Replace Entire Ramp.		N/A	Ramp Length (in)	118.0	N/A
			No	Ramp Width (in)	38.0	N/A
			No	Ramp Slope (%)	17.1	N/A
			No	Ramp XSlope (%)	2.4	N/A
			N/A	Flare Type LT	N/A	N/A
			N/A	Flare Slope LT (%)	N/A	N/A
			N/A	Flare Traversable LT?	N/A	N/A
			N/A	Flare Type RT	N/A	N/A
			N/A	Flare Slope RT (%)	N/A	N/A
<p>Surveyor Notes:</p> <p>N/A</p>			N/A	Flare Traversable RT?	N/A	N/A
			N/A	Landing Length (in)	0.0	N/A
			N/A	Landing Width (in)	0.0	N/A
			N/A	Landing Slope (%)	0.0	N/A
			N/A	Landing X Slope (%)	0.0	N/A
			N/A	Landing Curb? (Y/N)	N/A	N/A
			N/A	Shared Landing?	N/A	N/A
			N/A	Gutter Ponding?	0.0	N/A
			N/A	Gutter Lip Ht (in)	0.0	N/A
			N/A	Painted X Walk1?	No	N/A
<p>PROW/ADA:</p> <p>R304.5.1, R304.2.2, R304.5.3</p>			N/A	X Walk 1 Direction	To N	N/A
			N/A	X Walk 1 Width (in)	N/A	N/A
			N/A	X Walk 1 Slope (%)	5.7	N/A
			N/A	X Walk 1 X Slope (%)	0.0	N/A
			N/A	Ramp inside XWalk1?	N/A	N/A
			N/A	Any Obstructions?	N/A	N/A
				Obstruction Type		N/A
			Yes	Surface Condition? (G/P)		Good
			N/A	Curb Slope (%)		N/A
Total Cost:		\$ 1600.00				

