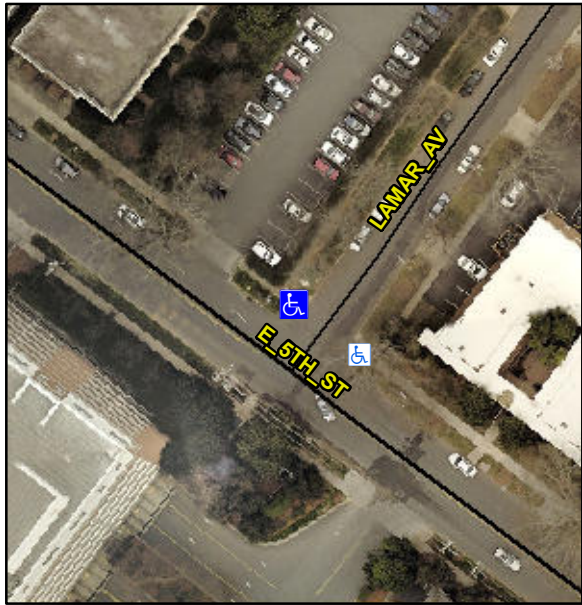


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 13988	Main Street: E_5TH_ST	Cross Street: LAMAR_AV	Location: NE
ADA ID: FBD2FF344426	Ramp Type: PerpDiag	Initial Pass/Fail: Fail	Overall Compliance: No
Severity Score: 8.75			
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

	Possible Solutions:		Compliance		Description	Data	Compliance	Description	Data
	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.		N/A	Ramp Length (in)	86.0	Yes	Ramp Slope (%)	5.2	
			No	Ramp Width (in)	46.0	Yes	Ramp XSlope (%)	0.8	
			N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A	
			N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A	
			N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A	
			N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A	
			N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A	
			N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A	
			N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A	
Surveyor Notes:		N/A	N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A	
PROW/ADA:		Not Found, R304.5.1	N/A	Shared Landing?	N/A	N/A			
			N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A	
			N/A	Gutter Lip Ht (in)	0.5	N/A	Gutter X Slope (%)	N/A	
			N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No	
				X Walk 1 Direction	To SW		X Walk 2 Direction	To SE	
			N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A	
				X Walk 1 Slope (%)	4.0		X Walk 2 Slope (%)	4.4	
				X Walk 1 X Slope (%)	2.0		X Walk 2 X Slope (%)	3.7	
			N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A	
				Road Slope (%)	1.8	N/A	Clear Space?	N/A	
				Road X Slope (%)	4.4	N/A	Clear Space to XWalk (in)	N/A	
			N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A	
				Obstruction Type			Storm Grate/Utility Type		
					N/A			N/A	
						Yes	Surface Condition? (G/P)	Good	
Total Cost:		\$	3200.00						

