


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 29153	Main Street: BRIAR_ROSE_CT	Cross Street: HIGHLAND_PARK_DR	Location: N
ADA ID: FC54765C2910	Ramp Type: PerpDiag	Initial Pass/Fail: Pass	Overall Compliance: No
Severity Score: 7.75			
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

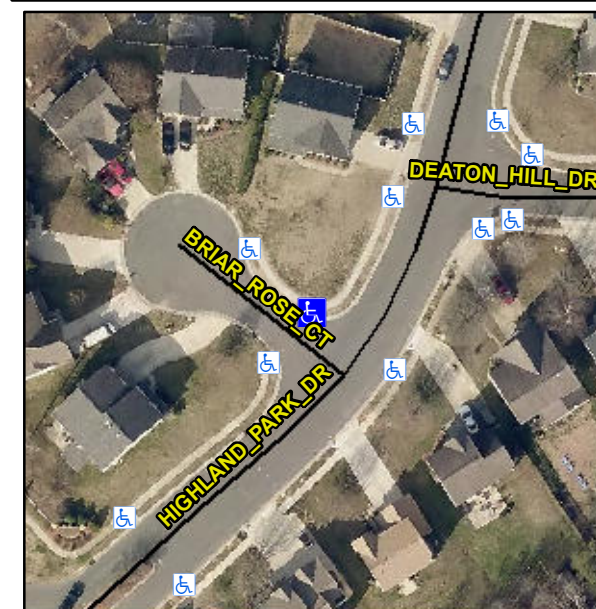

Possible Solutions:

**Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Grind Gutter Lip.**

Surveyor Notes:

**N/A**

PROW/ADA:

**R304.5.3, R304.2.1, R305.1.4, R305.2, R302.7.2**

Total Cost: \$ 3400.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	47.0	Yes	Ramp Slope (%)	6.0
Yes	Ramp Width (in)	48.0	No	Ramp XSlope (%)	2.2
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	4.6	Yes	Flare Slope RT (%)	9.8
N/A	Flare Traversable LT?	Yes	N/A	Flare Traversable RT?	Yes
No	Landing Length (in)	47.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	48.0	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	0.8	No	DWS Length (in)	23.0
No	Landing X Slope (%)	2.8	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	No	DWS Offset (in)	2.5
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	2.9
No	Gutter Lip Ht (in)	0.5	Yes	Gutter X Slope (%)	0.7
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To SW		X Walk 2 Direction	To SE
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	0.9		X Walk 2 Slope (%)	1.2
	X Walk 1 X Slope (%)	15.0		X Walk 2 X Slope (%)	0.9
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	1.9	N/A	Clear Space?	Yes
	Road X Slope (%)	0.9	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good

