


Access Compliance Report Public Rights-of-Way (Curb Ramps)

Intersection ID: 10038838	Main Street: STEELECROFT_PY	Cross Street: N/A	Location: N
ADA ID: FC6985B4E6CF	Ramp Type: PerpDiag	Initial Pass/Fail: Fail	Overall Compliance: No Severity Score: 22.5

Codes/Mitigation Info/Possible Solution	Field Measurements/Component Compliance
---	---

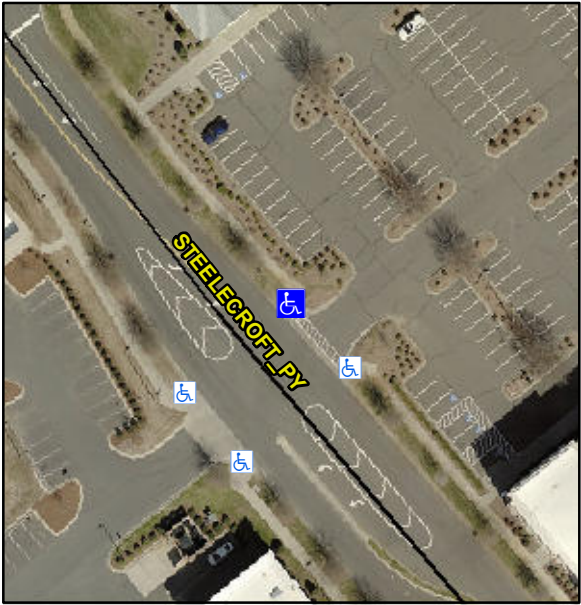

Possible Solutions:
Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:
N/A

PROW/ADA:
Not Found, R304.5.1, R304.2.2, R304.5.3

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	102.0	No	Ramp Slope (%)	8.7
No	Ramp Width (in)	38.0	No	Ramp XSlope (%)	3.7
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	N/A			
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	Yes
	X Walk 1 Direction	To E		X Walk 2 Direction	To SE
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	52.0
	X Walk 1 Slope (%)	0.7		X Walk 2 Slope (%)	0.2
	X Walk 1 X Slope (%)	0.6		X Walk 2 X Slope (%)	3.5
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	Yes
	Road Slope (%)	3.0	N/A	Clear Space?	N/A
	Road X Slope (%)	1.8	N/A	Clear Space to XWalk (in)	N/A
N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
	Obstruction Type			Storm Grate/Utility Type	
			N/A		N/A
			Yes	Surface Condition? (G/P)	Good

Total Cost: \$ 3200.00

Street 1 Name: STEELECROFT PY
 Stop Condition-Street 2: None
 Street 2 Name: ENTRANCE
 Stop Condition-Street 1: StopSign

