


Access Compliance Report

Public Rights-of-Way (Curb Ramps)

Intersection ID: N/A	Main Street: S_BREVARD_ST	Cross Street: E_STONEWALL_ST	Location: SW
ADA ID: FCEED38AC765	Ramp Type: Directional1	Initial Pass/Fail: Pass	Overall Compliance: No
Severity Score: 0			
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

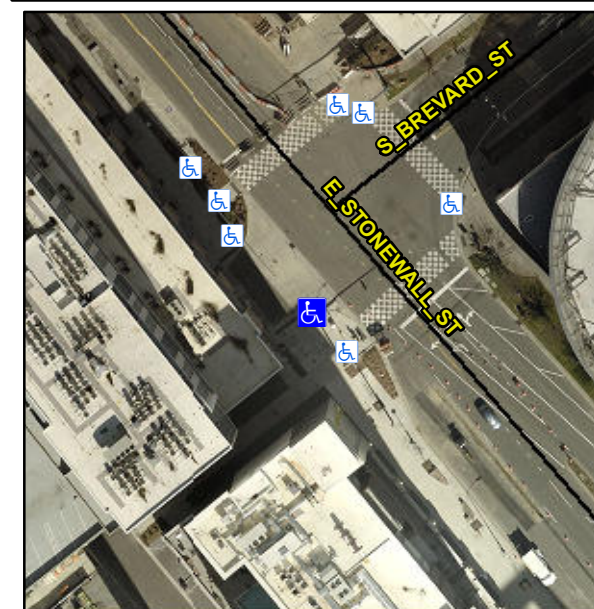

Possible Solutions:

Remove & Replace Detectable Warning System.

Surveyor Notes:

N/A

PROW/ADA:

R305.2

Total Cost:

\$ 800.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	45.0	Yes	Grade Break?	Yes
Yes	Ramp Width (in)	60.0	Yes	Grade Break Slope (%)	2.3
Yes	Ramp Slope (%)	0.9	Yes	Grade Break XSlope (%)	0.3
Yes	Ramp XSlope (%)	0.2			
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
Yes	Flare Slope LT (%)	1.7	Yes	Flare Slope RT (%)	1.0
N/A	Flare Traversable LT?	Yes	N/A	Flare Traversable RT?	Yes
Yes	Landing Length (in)	48.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	48.0	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	0.0	Yes	DWS Length (in)	24.0
Yes	Landing X Slope (%)	0.1	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	N/A	No	DWS Offset LT (in)	13.0
N/A	Shared Landing?	No	Yes	DWS Offset RT (in)	26.0
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	4.8
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	0.1
N/A	Painted X Walk1?	Yes		Road Slope (%)	0.2
	X Walk 1 Direction	To NW		Road X Slope (%)	0.1
	X Walk 1 Width (in)	153.0		Clear Space?	Yes
	X Walk 1 Slope (%)	0.2	N/A	Clear Space to XWalk (in)	N/A
	X Walk 1 X Slope (%)	0.1	Yes	Storm Grate/Utility Hazard?	No
Yes	Ramp inside XWalk1?	Yes		Storm Grate/Utility Type	
Yes	Any Obstructions?	No			N/A
	Obstruction Type		Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	0.1

Street 1 Name	S BREVARD ST
Stop Condition-Street 1	Signal
Street 2 Name	N/A
Stop Condition-Street 2	N/A

