

Access Compliance Report


Public Rights-of-Way

(Curb Ramps)

Intersection ID: 8592	Main Street: PERIWINKLE_HILL_AV	Cross Street: IKEA_BV	Location:	E
ADA ID: FD2BA1D31254	Ramp Type: Directional1	Initial Pass/Fail: Pass	Overall Compliance: No	Severity Score: 0

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

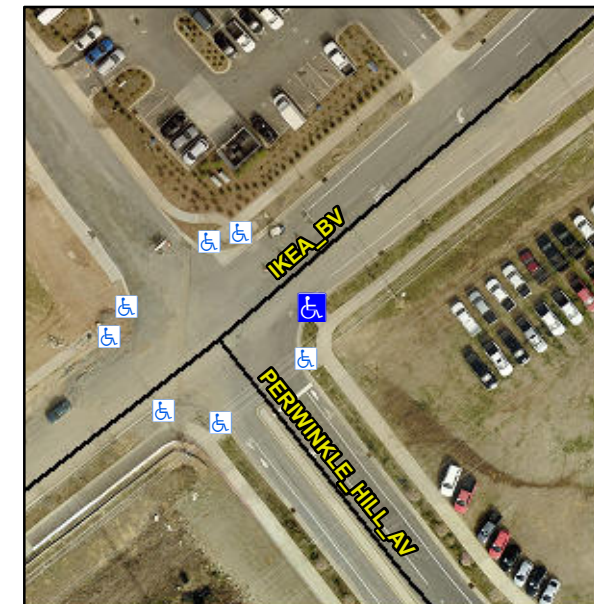

Possible Solutions:

**Remove & Replace Entire Ramp.
Gutter Ponding Observed.**

Surveyor Notes:

N/A

PROW/ADA:

R304.5.3, R302.7

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	84.0	Yes	Grade Break?	Yes
Yes	Ramp Width (in)	90.0	No	Grade Break Slope (%)	7.5
Yes	Ramp Slope (%)	5.8	Yes	Grade Break XSlope (%)	1.9
Yes	Ramp XSlope (%)	1.9			
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
Yes	Landing Length (in)	80.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	69.0	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	0.2	Yes	DWS Length (in)	24.5
No	Landing X Slope (%)	5.2	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	N/A	Yes	DWS Offset LT (in)	24.0
N/A	Shared Landing?	No	Yes	DWS Offset RT (in)	0.0
No	Gutter Ponding?	Yes	Yes	Gutter Slope (%)	2.1
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	3.4
N/A	Painted X Walk1?	No		Road Slope (%)	1.8
	X Walk 1 Direction	To NW		Road X Slope (%)	3.5
	X Walk 1 Width (in)	N/A		Clear Space?	Yes
	X Walk 1 Slope (%)	1.8	N/A	Clear Space to XWalk (in)	N/A
	X Walk 1 X Slope (%)	3.5	Yes	Storm Grate/Utility Hazard?	No
N/A	Ramp inside XWalk1?	N/A		Storm Grate/Utility Type	
Yes	Any Obstructions?	No			N/A
	Obstruction Type		Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	N/A

Total Cost: \$ 2100.00

