


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 27452	Main Street: BALLANTYNE_COMMONS_PY	Cross Street: BALLANTYNE_CORPORATE_PL	Location: NW
ADA ID: FDF50F9732DF	Ramp Type: Directional1	Initial Pass/Fail: Pass	Overall Compliance: No
Severity Score: 2.75			
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

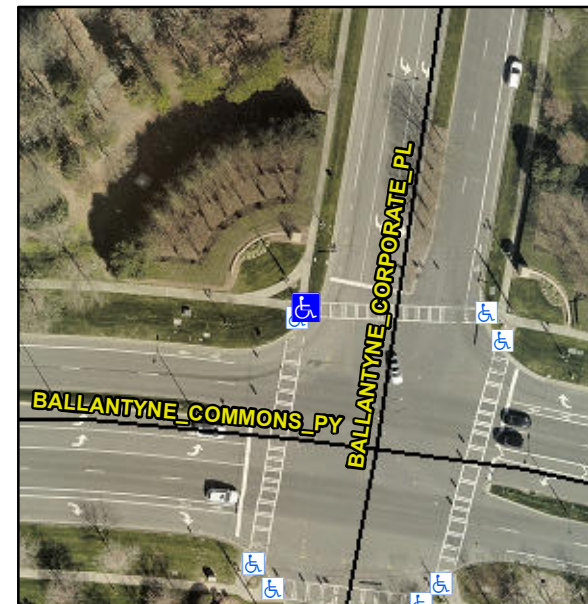

Possible Solutions:

**Remove & Replace Entire Ramp.
Remove & Replace Gutter.**

Surveyor Notes:

N/A

PROW/ADA:

**R304.2.2-Perp, R304.3.2-Para,
R304.5.3, R305.1.4**

Street 1 Name **BALLANTYNE CORPORATE PL**
 Stop Condition-Street 1 **Signal**
 Street 2 Name **N/A**
 Stop Condition-Street 2 **N/A**

Total Cost: \$ **2350.00**

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	23.0	N/A	Grade Break?	N/A
Yes	Ramp Width (in)	57.0	N/A	Grade Break Slope (%)	0.0
Yes	Ramp Slope (%)	1.0	N/A	Grade Break XSlope (%)	0.0
Yes	Ramp XSlope (%)	2.5			
Yes	Flare Type LT	N/A	Yes	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
Yes	Landing Length (in)	62.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	72.0	Yes	DWS Contrast?	Yes
No	Landing Slope (%)	2.4	Yes	DWS Length (in)	26.0
No	Landing X Slope (%)	3.0	No	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	No	Yes	DWS Offset LT (in)	0.0
N/A	Shared Landing?	Yes	Yes	DWS Offset RT (in)	0.0
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	3.1
Yes	Gutter Lip Ht (in)	0.0	No	Gutter X Slope (%)	4.6
N/A	Painted X Walk1?	Yes		Road Slope (%)	2.4
	X Walk 1 Direction	To E		Road X Slope (%)	2.9
	X Walk 1 Width (in)	99.0		Clear Space?	Yes
	X Walk 1 Slope (%)	2.4	N/A	Clear Space to XWalk (in)	N/A
	X Walk 1 X Slope (%)	2.9	Yes	Storm Grate/Utility Hazard?	No
Yes	Ramp inside XWalk1?	Yes		Storm Grate/Utility Type	
Yes	Any Obstructions?	No			N/A
	Obstruction Type		Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	8.0

