


# Access Compliance Report

## Public Rights-of-Way (Curb Ramps)

Intersection ID: 3750	Main Street: DEER_CROSS_TL	Cross Street: HERITAGE_WOODS_PL	Location: SW
ADA ID: FE9A24F42A18	Ramp Type: Directional1	Initial Pass/Fail: Fail	Overall Compliance: No
			Severity Score: 21.25

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance		
	Possible Solutions:		<b>Compliance</b>	<b>Description</b>	<b>Data</b>
	Remove & Replace Entire Ramp.		N/A	Ramp Length (in)	32.0
			No	Ramp Width (in)	40.0
			No	Ramp Slope (%)	9.7
			Yes	Ramp XSlope (%)	0.9
			N/A	Flare Type LT	N/A
			N/A	Flare Slope LT (%)	N/A
			N/A	Flare Traversable LT?	N/A
			N/A	Flare Type RT	N/A
			N/A	Flare Slope RT (%)	0.0
<p>Surveyor Notes:</p> <p>N/A</p>			N/A	Grade Break?	N/A
			N/A	Grade Break Slope (%)	0.0
			N/A	Grade Break XSlope (%)	0.0
			N/A	Flare Type RT	N/A
			N/A	Flare Slope RT (%)	0.0
			N/A	Flare Traversable RT?	N/A
			N/A	DWS Provided?	N/A
			N/A	DWS Contrast?	N/A
			N/A	DWS Length (in)	N/A
			N/A	DWS Full Width?	N/A
<p>PROW/ADA:</p> <p>R304.5.1, R304.2.2</p>			N/A	DWS Offset LT (in)	N/A
			N/A	DWS Offset RT (in)	N/A
			N/A	Gutter Slope (%)	N/A
			N/A	Gutter Lip Ht (in)	N/A
			N/A	Gutter X Slope (%)	N/A
			N/A	Road Slope (%)	1.3
			N/A	Road X Slope (%)	4.0
			N/A	Clear Space?	N/A
			N/A	Clear Space to XWalk (in)	N/A
			N/A	Storm Grate/Utility Hazard?	N/A
<p>Total Cost:</p> <p>\$ 1600.00</p>			N/A	Storm Grate/Utility Type	N/A
			N/A	Obstruction Type	N/A
			Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	12.6

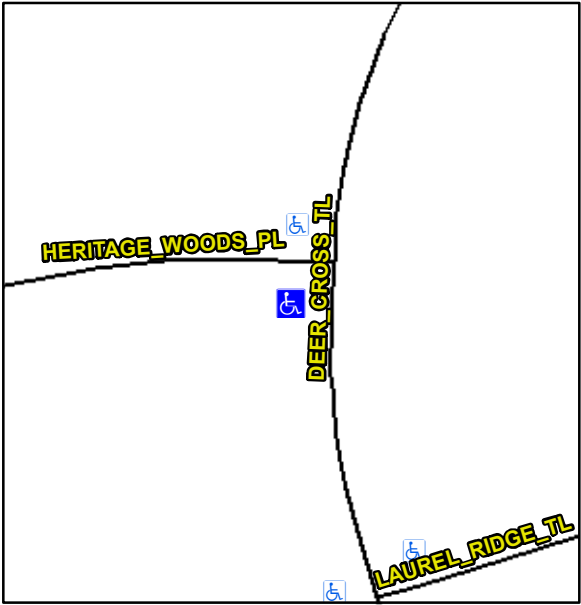