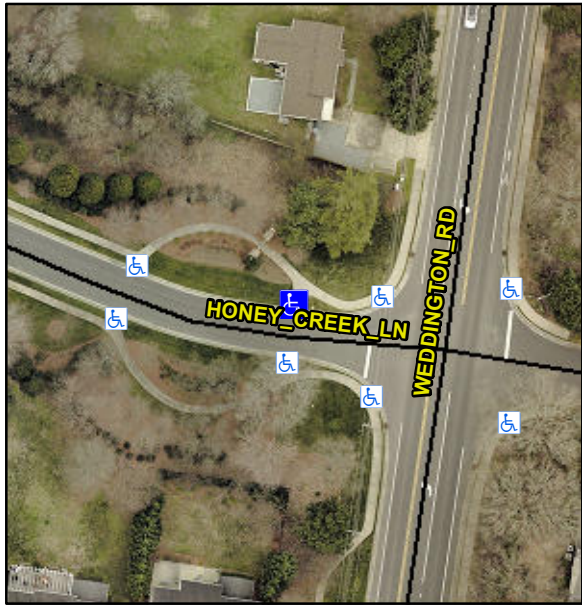


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 10028595	Main Street: HONEY_CREEK_LN	Cross Street: WEDDINGTON_RD	Location:	N
ADA ID: FF6A01364AEA	Ramp Type: BlendTrans1	Initial Pass/Fail: Pass	Overall Compliance: No	Severity Score: 10

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance					
	Possible Solutions:		Compliance	Description	Data	Compliance	Description	Data
	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter.		N/A	Ramp Length (in)	64.0	Yes	BlendTrans Slope (%)	5.0
			Yes	Ramp Width (in)	72.0	Yes	BlendTrans XSlope (%)	1.2
			N/A	Flare Type LT	None	N/A	Flare Type RT	None
			N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
			N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
			Yes	Landing Length (in)	54.0	No	DWS Provided?	No
			Yes	Landing Width (in)	72.0	N/A	DWS Contrast?	No
			No	Landing Slope (%)	3.7	N/A	DWS Length (in)	N/A
			Yes	Landing X Slope (%)	1.2	N/A	DWS Full Width?	No
Surveyor Notes: N/A PROW/ADA: Not Found, R304.2.2-Perp, R304.3.2-Para, R305, R304.5.3			N/A	Landing Curb? (Y/N)	No	N/A	DWS Offset (in)	N/A
			N/A	Shared Landing?	No			
			Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	2.6
			Yes	Gutter Lip Ht (in)	0.0	No	Gutter X Slope (%)	2.1
			N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
				X Walk 1 Direction	To S		X Walk 2 Direction	N/A
				X Walk 1 Width (in)	N/A		X Walk 2 Width (in)	N/A
				X Walk 1 Slope (%)	3.7		X Walk 2 Slope (%)	N/A
				X Walk 1 X Slope (%)	0.6		X Walk 2 X Slope (%)	N/A
			N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
			Road Slope (%)	0.6		Clear Space?	Yes	
			Road X Slope (%)	3.7	N/A	Clear Space to XWalk (in)	N/A	
		Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No	
			Obstruction Type			Storm Grate/Utility Type		
					N/A			N/A
						Yes	Surface Condition? (G/P)	Good
						No	Curb Slope (%)	10.6

