


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 15459	Main Street: CONISTON_PL	Cross Street: S_KINGS_DR	Location: SE
ADA ID: FFA5BFA87B92	Ramp Type: Directional1	Initial Pass/Fail: Pass	Overall Compliance: No
Severity Score: 0.25			
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

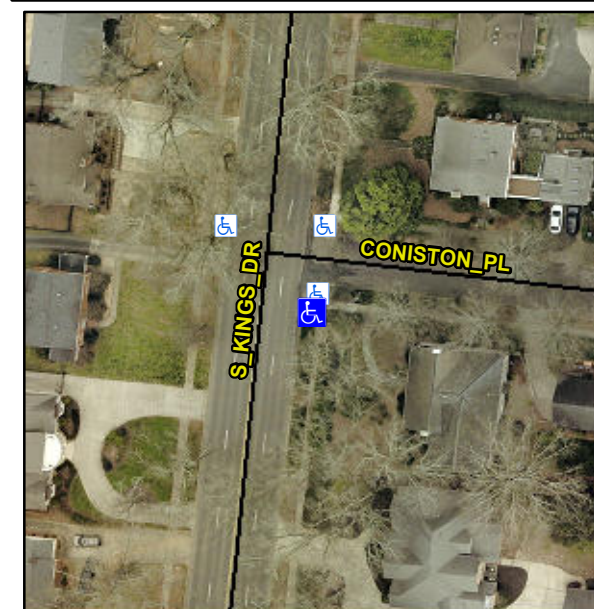

Possible Solutions:

**Remove & Replace Entire Ramp.
Gutter Ponding Observed.**

Surveyor Notes:

N/A

PROW/ADA:

R304.5.3, R304.5.2, R302.7

Total Cost:

\$ 2100.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	73.0	No	Grade Break?	No
Yes	Ramp Width (in)	52.0	N/A	Grade Break Slope (%)	6.5
Yes	Ramp Slope (%)	6.4	N/A	Grade Break XSlope (%)	1.4
No	Ramp XSlope (%)	2.1			
N/A	Flare Type LT	N/A	Yes	Flare Type RT	N/A
Yes	Flare Slope LT (%)	2.2	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	Yes	N/A	Flare Traversable RT?	No
Yes	Landing Length (in)	51.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	53.0	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	0.7	Yes	DWS Length (in)	24.0
Yes	Landing X Slope (%)	0.9	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	N/A	Yes	DWS Offset LT (in)	1.0
N/A	Shared Landing?	Yes	Yes	DWS Offset RT (in)	19.0
No	Gutter Ponding?	Yes	Yes	Gutter Slope (%)	4.6
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	0.5
N/A	Painted X Walk1?	No		Road Slope (%)	3.6
	X Walk 1 Direction	To W		Road X Slope (%)	0.8
	X Walk 1 Width (in)	N/A		Clear Space?	Yes
	X Walk 1 Slope (%)	3.6	N/A	Clear Space to XWalk (in)	N/A
	X Walk 1 X Slope (%)	0.8	Yes	Storm Grate/Utility Hazard?	No
N/A	Ramp inside XWalk1?	N/A		Storm Grate/Utility Type	
Yes	Any Obstructions?	No			N/A
	Obstruction Type		Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	5.7

