

Access Compliance Report Public Rights-of-Way (Pedestrian Signals)



Data

N/A

N/A

N/A

N/A

N/A

N/A

N/A N/A

N/A

N/A N/A

N/A

N/A

N/A

N/A

Intersection ID: N/A **Main Street:** Cross Street: N/A Location: N/A

Signal Type: One Push Button-Non APS Severity Score: BTN 1:N/A BTN 2: N/A No BTN: N/A ADA ID: 10A7BE0A9258 **Overall Compliance: No**

Compliance Description

N/A Signal Buttons Required?

Additional Button Present?

How Many Ped Street Xings?

Yes B 1 Sign Lettering & Contrast?

N/A B 1 FWD Approach Reach (in)

N/A B 1 FWD Approach Width (in)

Button Count

N/A B 1 Sign Present?

Yes B 1 Sign Purpose?

Yes B 1 Parallel To XWalk?

B 1 PAR to Button?

B 1 PAR to XWalk?

No B 1 Clear Floor Space?

No B 1 FWD Approach?

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

Compliance Description

Button1 N/A Distant to Additional Button (in)

Yes N/A B 2 Sign Present?

Yes N/A B 2 Sign Purpose?

Yes N/A B 2 Parallel To XWalk?

No N/A B 2 PAR to Button?

No N/A B 2 PAR to XWalk?

No N/A B 2 FWD Approach?

No N/A B 2 Clear Floor Space?

Additional Button ID

N/A N/A Additional Ped Posts Required

Yes N/A B 2 Sign Lettering & Contrast?

N/A N/A B 2 FWD Approach Constrained?


N/A N/A B 2 FWD Approach Reach (in)

N/A N/A B 2 FWD Approach Width (in)

Located In An Island/Median?

Data

N/A

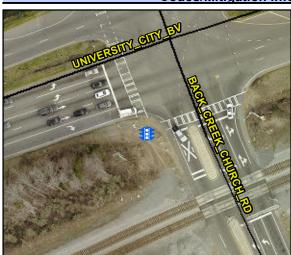

Possible Solutions: Replace Signal Push Button With APS Button on New Post. Remove & Relocate Sign.

Surveyor Notes: N/A

PROW/ADA: TMUTCD 4e.08, R404.3, R404.1, R404.7.1, R404.7.2

Total Cost:

650.00 N/A B 1 FWD Approach Constrained?





		一种 经 。在 下中的 图	• • • • • • • • • • • • • • • • • • • •		11 ()	
		A MARIE AND PARTY OF THE PARTY	N/A B 1 FWD Approach Obstruction?	Yes N/A	B 2 FWD Approach Obstruction?	N/A
			N/A B 1 FWD Approach Obstruction Dist (in)	3.0 N/A	B 2 FWD Approach ObstructionDist (in)	N/A
			No B 1 PARA Approach?	No N/A	B 2 PARA Approach?	N/A
	P. Carlotte		N/A B 1 PARA Approach Constrained?	N/A N/A	B 2 PARA Approach Constrained?	N/A
			N/A B 1 PARA Approach Reach (in)	N/A N/A	B 2 PARA Approach Reach (in)	N/A
		A Charles	N/A B 1 PARA Approach Width (in)	N/A N/A	B 2 PARA Approach Width (in)	N/A
			N/A B 1 PARA Approach Obstruction?	Yes N/A	B 2 PARA Approach Obstruction?	N/A
APS Compliance			N/A B 1 PARA Approach Obstruction Dist (in)	3.0 N/A	B 2 PARA Approach ObstructionDist (in)	N/A
Is Button 1 APS or Non-APS?	NonAPS Is Button 2 APS or Non-APS?	N/A	N/A B 1 Clear Floor Space Slope (%)	N/A N/A	B 2 Clear Floor Space Slope (%)	N/A
N/A B 1 VibroTact Arrow?	N/A N/A B 2 VibroTact Arrow?	N/A	N/A B 1 Clear Floor Space XSlope (%)	N/A N/A	B 2 Clear Floor Space XSlope (%)	N/A
N/A B 1 VibroTact Parallel to Xing?	N/A N/A B 2 VibroTact Parallel to Xing?	N/A	N/A B 1 PAR Slope (%)	N/A N/A	B 2 PAR Slope (%)	N/A
N/A B 1 VibroTact Contrast	N/A N/A B 2 VibroTact Contrast	N/A	Yes B 1 Height (in)	32.0 N/A	B 2 Height (in)	N/A
N/A B 1 Pilot Light?	N/A N/A B 2 Pilot Light?	N/A	Yes B 1 Pressure (#)	2.0 N/A	B 2 Pressure (#)	N/A
N/A B 1 Pilot Light Illumination?	N/A N/A B 2 Pilot Light Illumination?	N/A	Yes B 1 Closed Fist Operation?	Yes N/A	B 2 Closed Fist Operation?	N/A
N/A B 1 Verbal Walk Cycle?	N/A N/A B 2 Verbal Walk Cycle?	N/A	MUTCD Compliance			
N/A B 1 Verbal Message Audible?	N/A N/A B 2 Verbal Message Audible?	N/A	N/A B 1 Clear Xing Direction?	Yes N/A	B 2 Clear Xing Direction?	N/A
N/A B 1 Locator Tone?	N/A N/A B 2 Locator Tone?	N/A	B 1 Crossing Direction	To NW	B 2 Crossing Direction	N/A
N/A B 1 Percussive Walk Cycle?	N/A N/A B 2 Percussive Walk Cycle?	N/A	Yes B 1 DistanceTo XWalk (in)	17.0 N/A	B 2 DistanceTo XWalk (in)	N/A
N/A B 1 Extended Press Feature?	N/A N/A B 2 Extended Press Feature?	N/A	No B 1 DistanceTo Curb (in)	133.0 N/A	B 2 DistanceTo Curb (in)	N/A
N/A B 1 Tone Audible Range?	N/A N/A B 2 Tone Audible Range?	N/A	Yes B 1 Diameter (in)	2.0 N/A	B 2 Diameter (in)	N/A
N/A B 1 Tone Audible Range?	N/A N/A B 2 Tone Audible Range?	N/A	Yes B 1 Diameter (in)	2.0 N/A	B 2 Diameter (in)	