

## **Access Compliance Report Public Rights-of-Way** (Pedestrian Signals)



Data

N/A

N/A

N/A

No

N/A

N/A

N/A N/A

N/A

N/A N/A

N/A

N/A

N/A

N/A

N/A

N/A

N/A

N/A

N/A

N/A

N/A

Intersection ID: N/A **Main Street:** Cross Street: N/A Location: N/A

Signal Type: One Push Button-Non APS Severity Score: BTN 1:N/A BTN 2: N/A No BTN: N/A ADA ID: 1F0E6AB3A965 **Overall Compliance: No** 

## Codes/Mitigation Info/Possible Solution

## Field Measurements/Component Compliance

Compliance Description

**Button1 N/A** Distant to Additional Button (in)

Yes N/A B 2 Sign Present?

Yes N/A B 2 Sign Purpose?

Yes N/A B 2 Parallel To XWalk?

64.0 N/A B 2 DistanceTo Curb (in)

2.0 N/A B 2 Diameter (in)

Additional Button ID

N/A N/A Additional Ped Posts Required

Yes N/A B 2 Sign Lettering & Contrast?

Located In An Island/Median?

Data

No



N/A B 1 Extended Press Feature?

N/A B 1 Tone Audible Range?

Possible Solutions: Remove and Replace Clear Space.

Surveyor Notes: N/A


PROW/ADA: R404.2, R404.3

Total Cost:

N/A N/A B 2 Extended Press Feature?

N/A N/A B 2 Tone Audible Range?



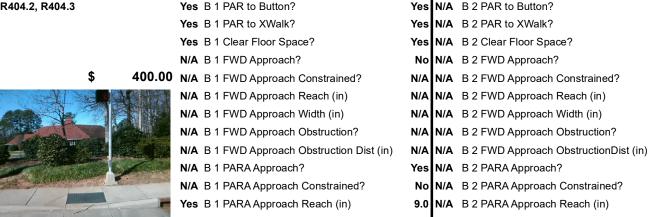

Yes B 1 DistanceTo Curb (in)

Yes B 1 Diameter (in)

Compliance Description

N/A Signal Buttons Required?

Additional Button Present?

How Many Ped Street Xings?

Yes B 1 Sign Lettering & Contrast?

**Button Count** 

N/A B 1 Sign Present?

Yes B 1 Sign Purpose?

Yes B 1 Parallel To XWalk?

				4			,	
				N/A B 1 PARA Approach Width (in)	N/A N	N/A	B 2 PARA Approach Width (in)	N/A
				N/A B 1 PARA Approach Obstruction?	? Yes N	N/A	B 2 PARA Approach Obstruction?	N/A
APS Compliance				N/A B 1 PARA Approach Obstruction	Dist (in) 3.0 N	N/A	B 2 PARA Approach ObstructionDist (in)	) <b>N/A</b>
Is Button 1 APS or Non-APS?	NonAPS	Is Button 2 APS or Non-APS?	N/A	No B 1 Clear Floor Space Slope (%)	) 4.2 N	N/A	B 2 Clear Floor Space Slope (%)	N/A
N/A B 1 VibroTact Arrow?	N/A N/	A B 2 VibroTact Arrow?	N/A	No B 1 Clear Floor Space XSlope (%	%) 7.9 N	N/A	B 2 Clear Floor Space XSlope (%)	N/A
N/A B 1 VibroTact Parallel to Xing?	<b>N/A N</b> //	A B 2 VibroTact Parallel to Xing?	N/A	N/A B 1 PAR Slope (%)	4.1 N	N/A	B 2 PAR Slope (%)	N/A
N/A B 1 VibroTact Contrast	<b>N/A N</b> //	A B 2 VibroTact Contrast	N/A	Yes B 1 Height (in)	42.0 N	N/A	B 2 Height (in)	N/A
N/A B 1 Pilot Light?	<b>N/A N</b> //	A B 2 Pilot Light?	N/A	Yes B 1 Pressure (#)	2.0 N	N/A	B 2 Pressure (#)	N/A
N/A B 1 Pilot Light Illumination?	N/A N/	A B 2 Pilot Light Illumination?	N/A	Yes B 1 Closed Fist Operation?	Yes	N/A	B 2 Closed Fist Operation?	N/A
N/A B 1 Verbal Walk Cycle?	N/A N/	A B 2 Verbal Walk Cycle?	N/A	MUTCD Compliance				
N/A B 1 Verbal Message Audible?	N/A N/	A B 2 Verbal Message Audible?	N/A	Yes B 1 Clear Xing Direction?	ClearlyMarked N	N/A	B 2 Clear Xing Direction?	N/A
N/A B 1 Locator Tone?	N/A N/	A B 2 Locator Tone?	N/A	B 1 Crossing Direction	To SE		B 2 Crossing Direction	N/A
N/A B 1 Percussive Walk Cycle?	N/A N/	A B 2 Percussive Walk Cycle?	N/A	Yes B 1 DistanceTo XWalk (in)	۱ 0.0	N/A	B 2 DistanceTo XWalk (in)	N/A

N/A

N/A