


# Access Compliance Report

## Public Rights-of-Way

### (Pedestrian Signals)

|                                         |                                   |                                         |                                                  |
|-----------------------------------------|-----------------------------------|-----------------------------------------|--------------------------------------------------|
| Intersection ID: N/A                    | Main Street:                      | Cross Street: N/A                       | Location: N/A                                    |
| ADA ID: 26ED4E01C597                    | Signal Type: Two Push Buttons-APS | Overall Compliance: No                  | Severity Score: BTN 1:N/A BTN 2: N/A No BTN: N/A |
| Codes/Mitigation Info/Possible Solution |                                   | Field Measurements/Component Compliance |                                                  |

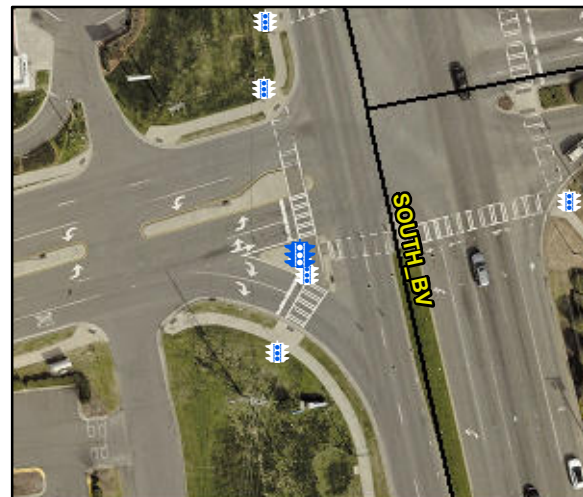

Possible Solutions: Replace Signal Push Button With APS Button on New Post.  
Remove & Relocate Sign. Remove & Replace Replace APS Button With New APS Button.  
Remove and Replace Clear Space.

Surveyor Notes: N/A

PROW/ADA: , TMUTCD 4e.08, R404.2, R404.7.3, R406.2

Total Cost: \$ 1800.00



| Compliance | Description                             | Data    | Compliance | Description                            | Data         |
|------------|-----------------------------------------|---------|------------|----------------------------------------|--------------|
|            | Button Count                            | Button2 | No         | Distant to Additional Button (in)      | 98.0         |
|            | Additional Button Present?              | Yes     |            | Additional Button ID                   | 781F9E44798B |
| N/A        | Signal Buttons Required?                | N/A     | N/A        | Additional Ped Posts Required          | N/A          |
|            | How Many Ped Street Xings?              | 3       |            | Located In An Island/Median?           | Yes          |
| N/A        | B 1 Sign Present?                       | Yes     | N/A        | B 2 Sign Present?                      | Yes          |
| Yes        | B 1 Sign Purpose?                       | Yes     | Yes        | B 2 Sign Purpose?                      | Yes          |
| Yes        | B 1 Sign Lettering & Contrast?          | Yes     | Yes        | B 2 Sign Lettering & Contrast?         | Yes          |
| Yes        | B 1 Parallel To XWalk?                  | Yes     | Yes        | B 2 Parallel To XWalk?                 | Yes          |
| Yes        | B 1 PAR to Button?                      | Yes     | Yes        | B 2 PAR to Button?                     | Yes          |
| Yes        | B 1 PAR to XWalk?                       | Yes     | Yes        | B 2 PAR to XWalk?                      | Yes          |
| Yes        | B 1 Clear Floor Space?                  | Yes     | Yes        | B 2 Clear Floor Space?                 | Yes          |
| N/A        | B 1 FWD Approach?                       | No      | N/A        | B 2 FWD Approach?                      | Yes          |
| N/A        | B 1 FWD Approach Constrained?           | N/A     | N/A        | B 2 FWD Approach Constrained?          | No           |
| N/A        | B 1 FWD Approach Reach (in)             | N/A     | No         | B 2 FWD Approach Reach (in)            | 16.0         |
| N/A        | B 1 FWD Approach Width (in)             | N/A     | N/A        | B 2 FWD Approach Width (in)            | N/A          |
| N/A        | B 1 FWD Approach Obstruction?           | N/A     | N/A        | B 2 FWD Approach Obstruction?          | Yes          |
| N/A        | B 1 FWD Approach Obstruction Dist (in)  | N/A     | N/A        | B 2 FWD Approach ObstructionDist (in)  | 11.0         |
| N/A        | B 1 PARA Approach?                      | Yes     | N/A        | B 2 PARA Approach?                     | Yes          |
| N/A        | B 1 PARA Approach Constrained?          | No      | N/A        | B 2 PARA Approach Constrained?         | No           |
| No         | B 1 PARA Approach Reach (in)            | 18.0    | No         | B 2 PARA Approach Reach (in)           | 16.0         |
| N/A        | B 1 PARA Approach Width (in)            | N/A     | N/A        | B 2 PARA Approach Width (in)           | N/A          |
| N/A        | B 1 PARA Approach Obstruction?          | Yes     | N/A        | B 2 PARA Approach Obstruction?         | Yes          |
| N/A        | B 1 PARA Approach Obstruction Dist (in) | 11.0    | N/A        | B 2 PARA Approach ObstructionDist (in) | 11.0         |
| Yes        | B 1 Clear Floor Space Slope (%)         | 1.2     | Yes        | B 2 Clear Floor Space Slope (%)        | 1.6          |
| No         | B 1 Clear Floor Space XSlope (%)        | 3.7     | No         | B 2 Clear Floor Space XSlope (%)       | 3.2          |
| N/A        | B 1 PAR Slope (%)                       | 1.4     | N/A        | B 2 PAR Slope (%)                      | 1.5          |
| Yes        | B 1 Height (in)                         | 31.0    | Yes        | B 2 Height (in)                        | 31.0         |
| Yes        | B 1 Pressure (#)                        | 2.0     | Yes        | B 2 Pressure (#)                       | 2.0          |
| Yes        | B 1 Closed Fist Operation?              | Yes     | Yes        | B 2 Closed Fist Operation?             | Yes          |

#### MUTCD Compliance

|     |                           |               |     |                           |               |
|-----|---------------------------|---------------|-----|---------------------------|---------------|
| Yes | B 1 Clear Xing Direction? | ClearlyMarked | Yes | B 2 Clear Xing Direction? | ClearlyMarked |
|     | B 1 Crossing Direction    | To NE         |     | B 2 Crossing Direction    | To NW         |
| Yes | B 1 DistanceTo XWalk (in) | 0.0           | Yes | B 2 DistanceTo XWalk (in) | 27.0          |
| No  | B 1 DistanceTo Curb (in)  | 178.0         | Yes | B 2 DistanceTo Curb (in)  | 72.0          |
| Yes | B 1 Diameter (in)         | 2.0           | Yes | B 2 Diameter (in)         | 2.0           |

#### APS Compliance

|                             |                                 |                             |                                 |
|-----------------------------|---------------------------------|-----------------------------|---------------------------------|
| Is Button 1 APS or Non-APS? | APS                             | Is Button 2 APS or Non-APS? | APS                             |
| Yes                         | B 1 VibroTact Arrow?            | Yes                         | B 2 VibroTact Arrow?            |
| Yes                         | B 1 VibroTact Parallel to Xing? | Yes                         | B 2 VibroTact Parallel to Xing? |
| Yes                         | B 1 VibroTact Contrast          | Yes                         | B 2 VibroTact Contrast          |
| Yes                         | B 1 Pilot Light?                | Yes                         | B 2 Pilot Light?                |
| Yes                         | B 1 Pilot Light Illumination?   | Yes                         | B 2 Pilot Light Illumination?   |
| Yes                         | B 1 Verbal Walk Cycle?          | Yes                         | B 2 Verbal Walk Cycle?          |
| Yes                         | B 1 Verbal Message Audible?     | Yes                         | B 2 Verbal Message Audible?     |
| Yes                         | B 1 Locator Tone?               | Yes                         | B 2 Locator Tone?               |
| No                          | B 1 Percussive Walk Cycle?      | Yes                         | B 2 Percussive Walk Cycle?      |
| Yes                         | B 1 Extended Press Feature?     | Yes                         | B 2 Extended Press Feature?     |
| Yes                         | B 1 Tone Audible Range?         | Yes                         | B 2 Tone Audible Range?         |