

Access Compliance Report Public Rights-of-Way (Pedestrian Signals)



Data

8F51D46545C2

199.0

N/A

No

N/A

N/A

N/A N/A

N/A

N/A

N/A

N/A

N/A

N/A

N/A

N/A

N/A

N/A

N/A

N/A

N/A

Intersection ID: N/A Main Street: Cross Street: N/A Location: N/A

ADA ID: 27C434F8108A Signal Type: One Push Button-APS Overall Compliance: No Severity Score: BTN 1:N/A BTN 2: N/A No BTN: N/A

Compliance Description

N/A Signal Buttons Required?

Additional Button Present?

How Many Ped Street Xings?

Yes B 1 Sign Lettering & Contrast?

No B 1 FWD Approach Reach (in)

N/A B 1 FWD Approach Width (in)

N/A B 1 FWD Approach Obstruction?

N/A B 1 PARA Approach Constrained?

B 1 DistanceTo Curb (in)

Yes B 1 Diameter (in)

N/A B 1 FWD Approach Obstruction Dist (in)

Button Count

N/A B 1 Sign Present?

Yes B 1 Sign Purpose?

Yes B 1 Parallel To XWalk?

Yes B 1 Clear Floor Space?
N/A B 1 FWD Approach?

N/A B 1 PARA Approach?

Yes B 1 PAR to Button?

Yes B 1 PAR to XWalk?

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

Compliance Description

Button1 Yes Distant to Additional Button (in)

Yes N/A B 2 Sign Present?

Yes N/A B 2 Sign Purpose?

Yes N/A B 2 Parallel To XWalk?

Yes N/A B 2 Clear Floor Space?

Yes N/A B 2 PAR to Button?

Yes N/A B 2 PAR to XWalk?

Yes N/A B 2 FWD Approach?

Yes N/A B 2 PARA Approach?

88.0 N/A B 2 DistanceTo Curb (in)

2.0 N/A B 2 Diameter (in)

Additional Button ID

N/A N/A Additional Ped Posts Required

Yes N/A B 2 Sign Lettering & Contrast?

No N/A B 2 FWD Approach Constrained?

No N/A B 2 FWD Approach Obstruction?

No N/A B 2 PARA Approach Constrained?

N/A N/A B 2 FWD Approach ObstructionDist (in)


8.0 N/A B 2 FWD Approach Reach (in)

N/A N/A B 2 FWD Approach Width (in)

Located In An Island/Median?

Data

Yes

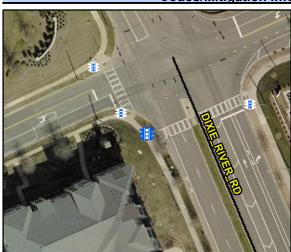

Yes B 1 Extended Press Feature?

Yes B 1 Tone Audible Range?

Possible Solutions: Replace Signal Push Button With APS Button on New Post. Remove & Relocate Sign.

Surveyor Notes: N/A

PROW/ADA: TMUTCD 4e.08, R404.2, R404.3, R406.2, R209.1, MUTCD 4e.10

Total Cost:

Yes N/A B 2 Extended Press Feature?

Yes N/A B 2 Tone Audible Range?

650.00 N/A B 1 FWD Approach Constrained?





				Yes B 1 PARA Approach Reach (in	n) 8.0 N	A B 2 PARA Approach Rea	ach (in) N/A
				N/A B 1 PARA Approach Width (in) N/A N	A B 2 PARA Approach Wid	dth (in) N/A
				N/A B 1 PARA Approach Obstructi	on? No N	A B 2 PARA Approach Ob	struction? N/A
APS Compliance				N/A B 1 PARA Approach Obstructi	on Dist (in) N/A N	A B 2 PARA Approach Ob	structionDist (in) N/A
Is Button 1 APS or Non-APS?	APS	Is Button 2 APS or Non-APS?	N/A	No B 1 Clear Floor Space Slope	(%) 3.8 N	A B 2 Clear Floor Space S	Slope (%) N/A
Yes B 1 VibroTact Arrow?	Yes N/A	A B 2 VibroTact Arrow?	N/A	No B 1 Clear Floor Space XSlope	e (%) 3.0 N	A B 2 Clear Floor Space X	(Slope (%) N/A
Yes B 1 VibroTact Parallel to Xing?	Yes N/A	A B 2 VibroTact Parallel to Xing?	N/A	N/A B 1 PAR Slope (%)	1.5 N	A B 2 PAR Slope (%)	N/A
Yes B 1 VibroTact Contrast	Yes N/A	A B 2 VibroTact Contrast	N/A	Yes B 1 Height (in)	38.0 N	A B 2 Height (in)	N/A
Yes B 1 Pilot Light?	Yes N/A	A B 2 Pilot Light?	N/A	Yes B 1 Pressure (#)	2.0 N	A B 2 Pressure (#)	N/A
Yes B 1 Pilot Light Illumination?	Yes N/A	A B 2 Pilot Light Illumination?	N/A	Yes B 1 Closed Fist Operation?	Yes N	A B 2 Closed Fist Operation	on? N/A
No B 1 Verbal Walk Cycle?	Yes N/A	A B 2 Verbal Walk Cycle?	N/A	MUTCD Compliance			
N/A B 1 Verbal Message Audible?	Yes N/A	A B 2 Verbal Message Audible?	N/A	Yes B 1 Clear Xing Direction?	ClearlyMarked N	A B 2 Clear Xing Direction	? N/A
Yes B 1 Locator Tone?	Yes N/A	A B 2 Locator Tone?	N/A	B 1 Crossing Direction	To NE	B 2 Crossing Direction	N/A
Yes B 1 Percussive Walk Cycle?	Yes N/A	A B 2 Percussive Walk Cycle?	N/A	Yes B 1 DistanceTo XWalk (in)	26.0 N	A B 2 DistanceTo XWalk (in) N/A

N/A

N/A