

## **Access Compliance Report Public Rights-of-Way** (Pedestrian Signals)



Data

D67A4F676384

180.0

N/A

No

N/A N/A

N/A N/A

N/A

N/A N/A

N/A

N/A

N/A

N/A

N/A

N/A

N/A

N/A

N/A

N/A

N/A

**Main Street:** Intersection ID: N/A Cross Street: N/A Location: N/A

ADA ID: 29C0EB56360A Signal Type: One Push Button-APS **Overall Compliance: No** Severity Score: BTN 1:N/A BTN 2: N/A No BTN: N/A

Compliance Description

Yes B 1 PARA Approach Reach (in)

B 1 DistanceTo Curb (in)

Yes B 1 Diameter (in)

**Button Count** 

## Codes/Mitigation Info/Possible Solution

## Field Measurements/Component Compliance

Compliance Description

**Button1 Yes** Distant to Additional Button (in)

7.0 N/A B 2 PARA Approach Reach (in)

115.0 N/A B 2 DistanceTo Curb (in)

2.0 N/A B 2 Diameter (in)

Data



Yes B 1 Extended Press Feature? Yes B 1 Tone Audible Range?

Possible Solutions: Replace Signal Push Button With APS Button on New Post. Remove & Relocate Sign.

Surveyor Notes: N/A


PROW/ADA: TMUTCD 4e.08, R404.2, R404.3, R406.2, R209.1, MUTCD 4e.10

Total Cost:

Yes N/A B 2 Extended Press Feature?

Yes N/A B 2 Tone Audible Range?



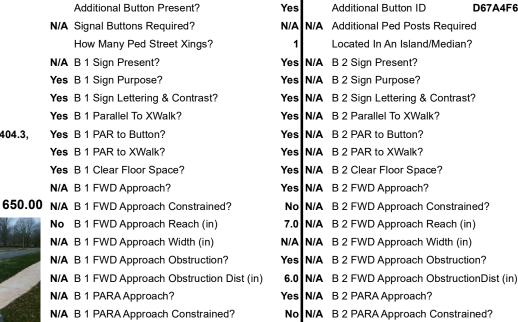



N/A N/A B 1 PARA Approach Width (in) N/A N/A B 2 PARA Approach Width (in) N/A B 1 PARA Approach Obstruction? Yes N/A B 2 PARA Approach Obstruction? N/A **APS Compliance** N/A B 1 PARA Approach Obstruction Dist (in) **6.0 N/A** B 2 PARA Approach Obstruction Dist (in) N/A Is Button 2 APS or Non-APS? Is Button 1 APS or Non-APS? **APS** No B 1 Clear Floor Space Slope (%) N/A 8.9 N/A B 2 Clear Floor Space Slope (%) N/A Yes B 1 VibroTact Arrow? Yes N/A B 2 VibroTact Arrow? N/A Yes B 1 Clear Floor Space XSlope (%) 1.0 N/A B 2 Clear Floor Space XSlope (%) N/A Yes B 1 VibroTact Parallel to Xing? Yes N/A B 2 VibroTact Parallel to Xing? N/A N/A B 1 PAR Slope (%) 8.4 N/A B 2 PAR Slope (%) N/A N/A N/A Yes B 1 VibroTact Contrast Yes N/A B 2 VibroTact Contrast Yes B 1 Height (in) 34.0 N/A B 2 Height (in) Yes B 1 Pilot Light? Yes N/A B 2 Pilot Light? N/A Yes B 1 Pressure (#) 3.0 N/A B 2 Pressure (#) N/A **N/A** B 2 Pilot Light Illumination? Yes B 1 Closed Fist Operation? Yes N/A B 2 Closed Fist Operation? N/A Yes B 1 Pilot Light Illumination? N/A No B 1 Verbal Walk Cycle? N/A B 2 Verbal Walk Cycle? N/A **MUTCD Compliance** ClearlyMarked N/A B 2 Clear Xing Direction? N/A B 1 Verbal Message Audible? N/A B 2 Verbal Message Audible? N/A Yes B 1 Clear Xing Direction? N/A N/A Yes B 1 Locator Tone? Yes N/A B 2 Locator Tone? N/A **B 1 Crossing Direction** To SE **B 2 Crossing Direction** N/A Yes B 1 Percussive Walk Cycle? Yes N/A B 2 Percussive Walk Cycle? N/A Yes B 1 DistanceTo XWalk (in) 0.0 N/A B 2 DistanceTo XWalk (in)

N/A

N/A