

Access Compliance Report Public Rights-of-Way (Pedestrian Signals)



Data

81F2D2B4EC51

218.0

N/A

No

N/A N/A

N/A N/A

N/A

N/A N/A

N/A

N/A

N/A

N/A

N/A

N/A

N/A

N/A

N/A

N/A

N/A

N/A

N/A

Main Street: Location: N/A Intersection ID: N/A Cross Street: N/A

ADA ID: 2ABB69DFBFC7 Signal Type: One Push Button-APS **Overall Compliance: No** Severity Score: BTN 1:N/A BTN 2: N/A No BTN: N/A

Compliance Description

N/A B 1 PARA Approach?

Yes B 1 Clear Xing Direction?

B 1 Crossing Direction

Yes B 1 DistanceTo XWalk (in)

Yes B 1 DistanceTo Curb (in)

Yes B 1 Diameter (in)

N/A B 1 PARA Approach Constrained?

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

Compliance Description

Yes N/A B 2 PARA Approach?

ClearlyMarked N/A B 2 Clear Xing Direction?

B 2 Crossing Direction

0.0 N/A B 2 DistanceTo XWalk (in)

36.0 N/A B 2 DistanceTo Curb (in)

2.0 N/A B 2 Diameter (in)

To E

No N/A B 2 PARA Approach Constrained?

Data



Possible Solutions: Remove & Replace Replace APS Button With New APS Button.

Surveyor Notes: N/A

PROW/ADA: R406.2, R404.7.3, R209.1, MUTCD 4e.10

Total Cost:

Yes N/A B 2 Verbal Message Audible?

Yes N/A B 2 Percussive Walk Cycle?

Yes N/A B 2 Tone Audible Range?

Yes N/A B 2 Extended Press Feature?

Yes N/A B 2 Locator Tone?

N/A

N/A

N/A

N/A

N/A




Button1 Yes Distant to Additional Button (in) **Button Count** Additional Button Present? Yes Additional Button ID N/A Signal Buttons Required? N/A N/A Additional Ped Posts Required How Many Ped Street Xings? Located In An Island/Median? N/A B 1 Sign Present? Yes N/A B 2 Sign Present? Yes B 1 Sign Purpose? Yes N/A B 2 Sign Purpose? Yes B 1 Sign Lettering & Contrast? Yes N/A B 2 Sign Lettering & Contrast? Yes B 1 Parallel To XWalk? Yes N/A B 2 Parallel To XWalk? Yes B 1 PAR to Button? Yes N/A B 2 PAR to Button? Yes B 1 PAR to XWalk? N/A B 2 PAR to XWalk? Yes B 1 Clear Floor Space? Yes N/A B 2 Clear Floor Space? Yes N/A B 2 FWD Approach? N/A B 1 FWD Approach? 750.00 N/A B 1 FWD Approach Constrained? **No N/A** B 2 FWD Approach Constrained? No B 1 FWD Approach Reach (in) 12.0 N/A B 2 FWD Approach Reach (in) N/A B 1 FWD Approach Width (in) N/A N/A B 2 FWD Approach Width (in) N/A B 1 FWD Approach Obstruction? Yes N/A B 2 FWD Approach Obstruction? N/A B 1 FWD Approach Obstruction Dist (in) 4.0 N/A B 2 FWD Approach ObstructionDist (in)



APS Compliance

APS

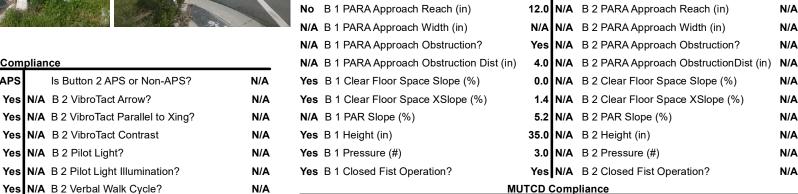

`	Is Button 1 APS or Non-APS?
Yes	B 1 VibroTact Arrow?
Yes	B 1 VibroTact Parallel to Xing?
Yes	B 1 VibroTact Contrast
Yes	B 1 Pilot Light?
Yes	B 1 Pilot Light Illumination?
No	B 1 Verbal Walk Cycle?
N/A	B 1 Verbal Message Audible?
Yes	B 1 Locator Tone?
Yes	B 1 Percussive Walk Cycle?
Yes	B 1 Extended Press Feature?
Yes	B 1 Tone Audible Range?