

Access Compliance Report Public Rights-of-Way (Pedestrian Signals)



Data

417225C9EFC8

274.0

N/A

No

N/A

N/A

N/A

N/A

N/A

N/A

Intersection ID: N/A **Main Street:** Cross Street: N/A Location: N/A

Signal Type: One Push Button-APS Severity Score: BTN 1:N/A BTN 2: N/A No BTN: ADA ID: 2D3DDBBD4177 **Overall Compliance: No** N/A

Compliance Description

N/A Signal Buttons Required?

Additional Button Present?

How Many Ped Street Xings?

Button Count

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

Compliance Description

Button1 Yes Distant to Additional Button (in)

Additional Button ID


N/A Additional Ped Posts Required

Located In An Island/Median?

Data

Yes

N/A

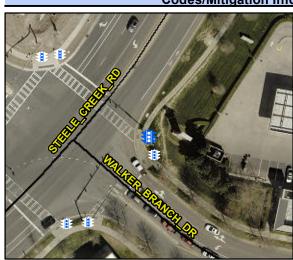

Possible Solutions: Replace Signal Push Button With APS Button on New Post. Remove & Relocate Sign.

Surveyor Notes: N/A

PROW/ADA: TMUTCD 4e.08, R209.1, MUTCD 4e.10

Total Cost:

650.0



		now many rea outeer mings:	•		Located III7 III Island/Median:	
	N/A	B 1 Sign Present?	Yes	N/A	B 2 Sign Present?	N/A
	Yes	B 1 Sign Purpose?	Yes	N/A	B 2 Sign Purpose?	N/A
	Yes	B 1 Sign Lettering & Contrast?	Yes	N/A	B 2 Sign Lettering & Contrast?	N/A
	Yes	B 1 Parallel To XWalk?	Yes	N/A	B 2 Parallel To XWalk?	N/A
	Yes	B 1 PAR to Button?	Yes	N/A	B 2 PAR to Button?	N/A
	Yes	B 1 PAR to XWalk?	Yes	N/A	B 2 PAR to XWalk?	N/A
	Yes	B 1 Clear Floor Space?	Yes	N/A	B 2 Clear Floor Space?	N/A
	N/A	B 1 FWD Approach?	No	N/A	B 2 FWD Approach?	N/A
00	N/A	B 1 FWD Approach Constrained?	N/A	N/A	B 2 FWD Approach Constrained?	N/A
100	N/A	B 1 FWD Approach Reach (in)	N/A	N/A	B 2 FWD Approach Reach (in)	N/A
A STATE OF THE PARTY OF THE PAR	N/A	B 1 FWD Approach Width (in)	N/A	N/A	B 2 FWD Approach Width (in)	N/A
	N/A	B 1 FWD Approach Obstruction?	N/A	N/A	B 2 FWD Approach Obstruction?	N/A
	N/A	B 1 FWD Approach Obstruction Dist (in)	N/A	N/A	B 2 FWD Approach ObstructionDist (in)	N/A
	N/A	B 1 PARA Approach?	Yes	N/A	B 2 PARA Approach?	N/A
	N/A	B 1 PARA Approach Constrained?	No	N/A	B 2 PARA Approach Constrained?	N/A
	Yes	B 1 PARA Approach Reach (in)	9.0	N/A	B 2 PARA Approach Reach (in)	N/A
	N/A	B 1 PARA Approach Width (in)	N/A	N/A	B 2 PARA Approach Width (in)	N/A
	N/A	B 1 PARA Approach Obstruction?	Yes	N/A	B 2 PARA Approach Obstruction?	N/A
	N/A	B 1 PARA Approach Obstruction Dist (in)	2.0	N/A	B 2 PARA Approach ObstructionDist (in)	N/A
	Yes	B 1 Clear Floor Space Slope (%)	2.0	N/A	B 2 Clear Floor Space Slope (%)	N/A
	Yes	B 1 Clear Floor Space XSlope (%)	0.6	N/A	B 2 Clear Floor Space XSlope (%)	N/A
	N/A	B 1 PAR Slope (%)	4.2	N/A	B 2 PAR Slope (%)	N/A
	Yes	B 1 Height (in)	40.0	N/A	B 2 Height (in)	N/A
	Yes	B 1 Pressure (#)	3.0	N/A	B 2 Pressure (#)	N/A



Yes	B 1 VibroTact Arrow?
Yes	B 1 VibroTact Parallel to Xing?
Yes	B 1 VibroTact Contrast
Yes	B 1 Pilot Light?
Yes	B 1 Pilot Light Illumination?
No	B 1 Verbal Walk Cycle?

Is Button 1 APS or Non-APS?

N/A B 1 Verbal Message Audible?

Yes B 1 Locator Tone?

Yes B 1 Percussive Walk Cycle?

Yes B 1 Extended Press Feature? Yes B 1 Tone Audible Range?

APS Compliance APS Is Button 2 APS or Non-APS? N/A Yes N/A B 2 VibroTact Arrow? N/A Yes N/A B 2 VibroTact Parallel to Xing? N/A Yes N/A B 2 VibroTact Contrast N/A Yes N/A B 2 Pilot Light? N/A Yes N/A B 2 Pilot Light Illumination? N/A Yes N/A B 2 Verbal Walk Cycle? Yes N/A B 2 Verbal Message Audible? Yes N/A B 2 Locator Tone? Yes N/A B 2 Percussive Walk Cycle?

Yes N/A B 2 Extended Press Feature?

Yes N/A B 2 Tone Audible Range?

Yes B 1 Closed Fist Operation? N/A N/A N/A N/A N/A N/A Yes B 1 Diameter (in)

Yes B 1 Clear Xing Direction? **B 1 Crossing Direction** Yes B 1 DistanceTo XWalk (in) No B 1 DistanceTo Curb (in)

To NW

MUTCD Compliance

ClearlyMarked N/A B 2 Clear Xing Direction? **B 2 Crossing Direction**

Yes N/A B 2 Closed Fist Operation?

42.0 N/A B 2 DistanceTo XWalk (in) 138.0 N/A B 2 DistanceTo Curb (in) 2.0 N/A B 2 Diameter (in)