

Access Compliance Report Public Rights-of-Way (Pedestrian Signals)



Data

N/A

N/A

N/A

No

N/A

N/A

N/A

N/A

N/A

N/A N/A

N/A

N/A

N/A

N/A

N/A

N/A

N/A N/A

N/A

Intersection ID: N/A **Main Street:** Cross Street: N/A Location: N/A

Severity Score: BTN 1:N/A BTN 2: N/A No BTN: N/A ADA ID: 2D6B3C320A10 Signal Type: One Push Button-Non APS **Overall Compliance: No**

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

No

Compliance Description

Button1 N/A Distant to Additional Button (in)

Yes N/A B 2 Sign Present?

Yes N/A B 2 Sign Purpose?

Yes N/A B 2 PAR to Button?

No N/A B 2 Parallel To XWalk?

Additional Button ID

N/A N/A Additional Ped Posts Required

Yes N/A B 2 Sign Lettering & Contrast?

B 2 PAR to XWalk?

B 2 FWD Approach?

B 2 PARA Approach?

B 2 Clear Floor Space?

B 2 FWD Approach Constrained?

B 2 FWD Approach Reach (in)

B 2 FWD Approach Width (in)


B 2 FWD Approach Obstruction?

B 2 PARA Approach Constrained? B 2 PARA Approach Reach (in)

B 2 FWD Approach ObstructionDist (in)

Located In An Island/Median?

Data

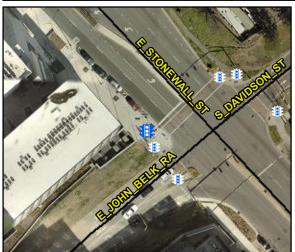

Possible Solutions: Replace Signal Push Button With APS Button on New Post. Remove & Relocate Sign.

Surveyor Notes: N/A

PROW/ADA: R209.1, TMUTCD 4e.08, R404.2, R406.2



	Yes B 1 PAR to XWalk?	Yes	N/A
	Yes B 1 Clear Floor Space?	Yes	N/A
	N/A B 1 FWD Approach?	Yes	N/A
\$ 650.00	N/A B 1 FWD Approach Constrained?	No	N/A
	No B 1 FWD Approach Reach (in)	3.0	N/A
	N/A B 1 FWD Approach Width (in)	N/A	N/A
	N/A B 1 FWD Approach Obstruction?	Yes	N/A
	N/A B 1 FWD Approach Obstruction Dist (in)	3.0	N/A
	N/A B 1 PARA Approach?	Yes	N/A
	N/A B 1 PARA Approach Constrained?	No	N/A
	Yes B 1 PARA Approach Reach (in)	3.0	N/A
The state of the s	N/A B 1 PARA Approach Width (in)	N/A	N/A

Compliance Description

N/A Signal Buttons Required?

Additional Button Present?

How Many Ped Street Xings?

Yes B 1 Sign Lettering & Contrast?

Button Count

N/A B 1 Sign Present?

Yes B 1 Sign Purpose?

Yes B 1 PAR to Button?

No B 1 Parallel To XWalk?

		1					• • • • • • • • • • • • • • • • • • • •	
		The state of the s		N/A B 1 PARA Approach Width (in)	N/A	N/A	B 2 PARA Approach Width (in)	N/A
				N/A B 1 PARA Approach Obstruction?	Yes	N/A	B 2 PARA Approach Obstruction?	N/A
APS Compliance				N/A B 1 PARA Approach Obstruction D	Dist (in) 3.0	N/A	B 2 PARA Approach ObstructionDist (in)	N/A
Is Button 1 APS or Non-APS?	NonAPS	Is Button 2 APS or Non-APS?	N/A	Yes B 1 Clear Floor Space Slope (%)	0.4	N/A	B 2 Clear Floor Space Slope (%)	N/A
N/A B 1 VibroTact Arrow?	N/A N/A	B 2 VibroTact Arrow?	N/A	No B 1 Clear Floor Space XSlope (%)) 2.6	N/A	B 2 Clear Floor Space XSlope (%)	N/A
N/A B 1 VibroTact Parallel to Xing?	N/A N/A	B 2 VibroTact Parallel to Xing?	N/A	N/A B 1 PAR Slope (%)	0.4	N/A	B 2 PAR Slope (%)	N/A
N/A B 1 VibroTact Contrast	N/A N/A	B 2 VibroTact Contrast	N/A	Yes B 1 Height (in)	40.0	N/A	B 2 Height (in)	N/A
N/A B 1 Pilot Light?	N/A N/A	B 2 Pilot Light?	N/A	Yes B 1 Pressure (#)	0.5	N/A	B 2 Pressure (#)	N/A
N/A B 1 Pilot Light Illumination?	N/A N/A	B 2 Pilot Light Illumination?	N/A	Yes B 1 Closed Fist Operation?	Yes	N/A	B 2 Closed Fist Operation?	N/A
N/A B 1 Verbal Walk Cycle?	N/A N/A	B 2 Verbal Walk Cycle?	N/A	MUTCD Compliance				
N/A B 1 Verbal Message Audible?	N/A N/A	B 2 Verbal Message Audible?	N/A	Yes B 1 Clear Xing Direction? C	learlyMarked	N/A	B 2 Clear Xing Direction?	N/A
N/A D 4 L to . To O	N/A N/A	D 0 1 t T 0	AI/A	D. A. Owner day of Discontinuo	T- NE		D 0 0 0 0 0 0 10 0 0 0 0 0 0 0 0 0 0 0 0	N1/A

N/A B 1 Locator Tone? N/A N/A B 2 Locator Tone? N/A **B 1 Crossing Direction B 2 Crossing Direction** N/A To NE N/A N/A B 1 Percussive Walk Cycle? N/A B 2 Percussive Walk Cycle? N/A Yes B 1 DistanceTo XWalk (in) 0.0 N/A B 2 DistanceTo XWalk (in) N/A B 1 Extended Press Feature? N/A N/A B 2 Extended Press Feature? N/A No B 1 DistanceTo Curb (in) 131.0 N/A B 2 DistanceTo Curb (in) N/A N/A B 1 Tone Audible Range? N/A N/A B 2 Tone Audible Range? N/A Yes B 1 Diameter (in) 2.0 N/A B 2 Diameter (in) N/A