

Yes Yes Yes Yes Yes Yes N/A Yes Yes

Yes B 1 Tone Audible Range?

Access Compliance Report Public Rights-of-Way (Pedestrian Signals)



Data

N/A

N/A

N/A

No

N/A

Intersection ID: N/A **Main Street:** Cross Street: N/A Location: N/A

Signal Type: One Push Button-APS **Overall Compliance: No** Severity Score: BTN 1:N/A BTN 2: N/A No BTN: N/A ADA ID: 303830A8E7D0

Compliance Description

N/A Signal Buttons Required?

Additional Button Present?

How Many Ped Street Xings?

No B 1 Sign Lettering & Contrast?

Button Count

N/A B 1 Sign Present?

Yes B 1 Sign Purpose?

Yes B 1 Parallel To XWalk?

B 1 PAR to Button?

B 1 PAR to XWalk?

B 1 Clear Floor Space? No B 1 FWD Approach?

N/A B 1 FWD Approach Reach (in)

N/A B 1 FWD Approach Width (in)

N/A B 1 FWD Approach Obstruction?

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

Compliance Description

Button1 N/A Distant to Additional Button (in)

Yes N/A B 2 Sign Present?

Yes N/A B 2 Sign Purpose?

Yes N/A B 2 Parallel To XWalk?

No N/A B 2 PAR to Button?

No N/A B 2 PAR to XWalk?

No N/A B 2 FWD Approach?

2.0 N/A B 2 Diameter (in)

No N/A B 2 Clear Floor Space?

Additional Button ID

N/A N/A Additional Ped Posts Required

No N/A B 2 Sign Lettering & Contrast?

No N/A B 2 FWD Approach Constrained?

N/A N/A B 2 FWD Approach Reach (in)


N/A N/A B 2 FWD Approach Width (in)

Yes N/A B 2 FWD Approach Obstruction?

Located In An Island/Median?

Data

No

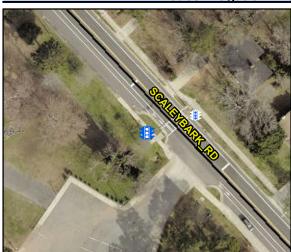

Possible Solutions: Replace Signal Push Button With APS Button on New Post. Remove & Replace Sign.

Surveyor Notes: TEXT HT 5/16

PROW/ADA: R410.6, TMUTCD 4e.08, R404.3, R404.1, R404.7.1, R404.7.2,

Total Cost:

Yes N/A B 2 Tone Audible Range?

700.00 N/A B 1 FWD Approach Constrained?





		TOKE CHAS	4	11		į.		
		PUSH BUTTON TO CROSS	N/A B	1 FWD Approach Obstruction Dis	st (in) 4.0	N/A	B 2 FWD Approach ObstructionDist (in)	N/A
			No B	1 PARA Approach?	No	N/A	B 2 PARA Approach?	N/A
22.00			N/A B	1 PARA Approach Constrained?	No	N/A	B 2 PARA Approach Constrained?	N/A
				1 PARA Approach Reach (in)	N/A	N/A	B 2 PARA Approach Reach (in)	N/A
			N/A B	1 PARA Approach Width (in)	N/A	N/A	B 2 PARA Approach Width (in)	N/A
			N/A B	1 PARA Approach Obstruction?	Yes	N/A	B 2 PARA Approach Obstruction?	N/A
APS Compliance			N/A B	1 PARA Approach Obstruction Di	ist (in) 4.0	N/A	B 2 PARA Approach ObstructionDist (in)) N/A
Is Button 1 APS or Non-APS?	APS Is Button 2 APS or No	Ion-APS? N/A	N/A B	1 Clear Floor Space Slope (%)	N/A	N/A	B 2 Clear Floor Space Slope (%)	N/A
s B 1 VibroTact Arrow?	Yes N/A B 2 VibroTact Arrow?	? N/A	N/A B	1 Clear Floor Space XSlope (%)	N/A	N/A	B 2 Clear Floor Space XSlope (%)	N/A
s B 1 VibroTact Parallel to Xing?	Yes N/A B 2 VibroTact Parallel	el to Xing? N/A	N/A B	1 PAR Slope (%)	N/A	N/A	B 2 PAR Slope (%)	N/A
s B 1 VibroTact Contrast	Yes N/A B 2 VibroTact Contras	ast N/A	Yes B	1 Height (in)	35.5	N/A	B 2 Height (in)	N/A
s B 1 Pilot Light?	Yes N/A B 2 Pilot Light?	N/A	Yes B	1 Pressure (#)	2.0	N/A	B 2 Pressure (#)	N/A
s B 1 Pilot Light Illumination?	Yes N/A B 2 Pilot Light Illumina	nation? N/A	Yes B	1 Closed Fist Operation?	Yes	N/A	B 2 Closed Fist Operation?	N/A
s B 1 Verbal Walk Cycle?	No N/A B 2 Verbal Walk Cycle	le? N/A		MUTCD Compliance				
A B 1 Verbal Message Audible?	Yes N/A B 2 Verbal Message A	Audible? N/A	Yes B	1 Clear Xing Direction? Cle	earlyMarked	N/A	B 2 Clear Xing Direction?	N/A
s B 1 Locator Tone?	Yes N/A B 2 Locator Tone?	N/A	В	1 Crossing Direction	To NE		B 2 Crossing Direction	N/A
s B 1 Percussive Walk Cycle?	Yes N/A B 2 Percussive Walk	Cycle? N/A	Yes B	1 DistanceTo XWalk (in)	19.0	N/A	B 2 DistanceTo XWalk (in)	N/A
B 1 Extended Press Feature?	No N/A B 2 Extended Press F	Feature? N/A	No B	1 DistanceTo Curb (in)	168.0	N/A	B 2 DistanceTo Curb (in)	N/A

N/A

Yes B 1 Diameter (in)