

Access Compliance Report

Public Rights-of-Way

(Pedestrian Signals)

Intersection ID: N/A	Main Street:	Cross Street: N/A	Location: N/A
ADA ID: 432F0101597F	Signal Type: Two Push Buttons-APS	Overall Compliance: No	Severity Score: BTN 1:N/A BTN 2: N/A No BTN: N/A
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	




Possible Solutions: Replace Signal Push Button With APS Button on New Post. Remove & Replace Sign.

Surveyor Notes: NO BUTTON PRESSURE
BTN 1, BUTTON NOT WORKING

PROW/ADA: R410.6, TMUTCD 4e.08, R404.2, R404.3, R406.2, R404.7.3, R403.4, R209.1, TMUTCD 4e.10, MUTCD 4e.08, R104.2,

Total Cost: \$ 1400.00

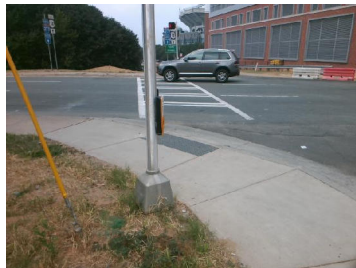

Compliance	Description	Data	Compliance	Description	Data
	Button Count	Button2	N/A	Distant to Additional Button (in)	N/A
	Additional Button Present?	N/A		Additional Button ID	N/A
N/A	Signal Buttons Required?	N/A	N/A	Additional Ped Posts Required	N/A
	How Many Ped Street Xings?	2		Located In An Island/Median?	No
N/A	B 1 Sign Present?	Yes	N/A	B 2 Sign Present?	Yes
Yes	B 1 Sign Purpose?	Yes	Yes	B 2 Sign Purpose?	Yes
No	B 1 Sign Lettering & Contrast?	No	No	B 2 Sign Lettering & Contrast?	No
Yes	B 1 Parallel To XWalk?	Yes	Yes	B 2 Parallel To XWalk?	Yes
Yes	B 1 PAR to Button?	Yes	Yes	B 2 PAR to Button?	Yes
Yes	B 1 PAR to XWalk?	Yes	Yes	B 2 PAR to XWalk?	Yes
Yes	B 1 Clear Floor Space?	Yes	Yes	B 2 Clear Floor Space?	Yes
N/A	B 1 FWD Approach?	Yes	N/A	B 2 FWD Approach?	Yes
N/A	B 1 FWD Approach Constrained?	No	N/A	B 2 FWD Approach Constrained?	No
No	B 1 FWD Approach Reach (in)	10.0	No	B 2 FWD Approach Reach (in)	10.0
N/A	B 1 FWD Approach Width (in)	N/A	N/A	B 2 FWD Approach Width (in)	N/A
N/A	B 1 FWD Approach Obstruction?	Yes	N/A	B 2 FWD Approach Obstruction?	Yes
N/A	B 1 FWD Approach Obstruction Dist (in)	4.0	N/A	B 2 FWD Approach ObstructionDist (in)	3.0
N/A	B 1 PARA Approach?	Yes	N/A	B 2 PARA Approach?	Yes
N/A	B 1 PARA Approach Constrained?	No	N/A	B 2 PARA Approach Constrained?	No
No	B 1 PARA Approach Reach (in)	12.0	Yes	B 2 PARA Approach Reach (in)	10.0
N/A	B 1 PARA Approach Width (in)	N/A	N/A	B 2 PARA Approach Width (in)	N/A
N/A	B 1 PARA Approach Obstruction?	Yes	N/A	B 2 PARA Approach Obstruction?	Yes
N/A	B 1 PARA Approach Obstruction Dist (in)	7.0	N/A	B 2 PARA Approach ObstructionDist (in)	3.0
No	B 1 Clear Floor Space Slope (%)	2.8	Yes	B 2 Clear Floor Space Slope (%)	1.4
Yes	B 1 Clear Floor Space XSlope (%)	0.2	Yes	B 2 Clear Floor Space XSlope (%)	1.0
N/A	B 1 PAR Slope (%)	0.2	N/A	B 2 PAR Slope (%)	4.7
Yes	B 1 Height (in)	39.0	Yes	B 2 Height (in)	38.0
No	B 1 Pressure (#)	N/A	Yes	B 2 Pressure (#)	2.0
Yes	B 1 Closed Fist Operation?	Yes	Yes	B 2 Closed Fist Operation?	Yes

MUTCD Compliance

Yes	B 1 Clear Xing Direction?	ClearlyMarked	Yes	B 2 Clear Xing Direction?	ClearlyMarked
	B 1 Crossing Direction	To NE		B 2 Crossing Direction	To NW
Yes	B 1 DistanceTo XWalk (in)	0.0	Yes	B 2 DistanceTo XWalk (in)	0.0
No	B 1 DistanceTo Curb (in)	92.0	No	B 2 DistanceTo Curb (in)	132.0
Yes	B 1 Diameter (in)	2.0	Yes	B 2 Diameter (in)	2.0

APS Compliance

Is Button 1 APS or Non-APS?	APS	Is Button 2 APS or Non-APS?	APS
No	B 1 VibroTact Arrow?	No	Yes
N/A	B 1 VibroTact Parallel to Xing?	N/A	Yes
N/A	B 1 VibroTact Contrast	N/A	Yes
No	B 1 Pilot Light?	No	Yes
N/A	B 1 Pilot Light Illumination?	N/A	Yes
N/A	B 1 Verbal Walk Cycle?	No	Yes
N/A	B 1 Verbal Message Audible?	N/A	Yes
No	B 1 Locator Tone?	No	Yes
N/A	B 1 Percussive Walk Cycle?	No	Yes
No	B 1 Extended Press Feature?	No	Yes
No	B 1 Tone Audible Range?	N/A	Yes
	B 2 VibroTact Arrow?	Yes	Yes
	B 2 VibroTact Parallel to Xing?	Yes	Yes
	B 2 VibroTact Contrast	Yes	Yes
	B 2 Pilot Light?	Yes	Yes
	B 2 Pilot Light Illumination?	Yes	Yes
	B 2 Verbal Walk Cycle?	Yes	Yes
	B 2 Verbal Message Audible?	Yes	Yes
	B 2 Locator Tone?	Yes	Yes
	B 2 Percussive Walk Cycle?	Yes	Yes
	B 2 Extended Press Feature?	Yes	Yes
	B 2 Tone Audible Range?	Yes	Yes