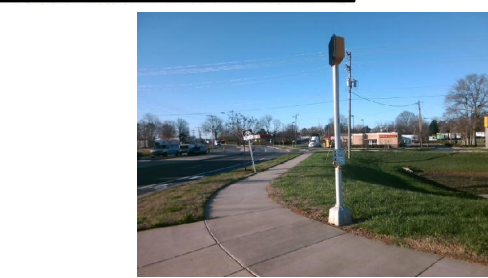
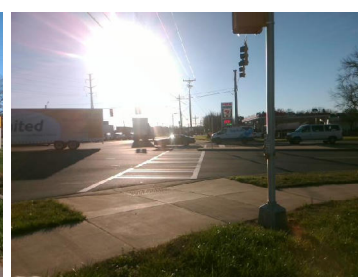
				Possible Solutions: Replace Signal Push Button With APS Button on New Post. Remove & Relocate Sign.			
Surveyor Notes: N/A				PROW/ADA: TMUTCD 4e.08, R404.2, R404.7.2			
							
Total Cost: \$ 650.00							
APS Compliance				Compliance	Description	Data	Compliance
Is Button 1 APS or Non-APS?	NonAPS	Is Button 2 APS or Non-APS?	N/A		Button Count	Button1	
N/A B 1 VibroTact Arrow?	No	N/A B 2 VibroTact Arrow?	N/A		Additional Button Present?	No	
N/A B 1 VibroTact Parallel to Xing?	No	N/A B 2 VibroTact Parallel to Xing?	N/A	N/A	Signal Buttons Required?	N/A	N/A
N/A B 1 VibroTact Contrast	No	N/A B 2 VibroTact Contrast	N/A		How Many Ped Street Xings?	N/A	
N/A B 1 Pilot Light?	No	N/A B 2 Pilot Light?	N/A	N/A	B 1 Sign Present?	Yes	N/A
N/A B 1 Pilot Light Illumination?	No	N/A B 2 Pilot Light Illumination?	N/A	Yes	B 1 Sign Purpose?	Yes	N/A
N/A B 1 Verbal Walk Cycle?	No	N/A B 2 Verbal Walk Cycle?	N/A	Yes	B 1 Sign Lettering & Contrast?	Yes	N/A
N/A B 1 Verbal Message Audible?	No	N/A B 2 Verbal Message Audible?	N/A	Yes	B 1 Parallel To XWalk?	Yes	N/A
N/A B 1 Locator Tone?	No	N/A B 2 Locator Tone?	N/A	Yes	B 1 PAR to Button?	Yes	N/A
N/A B 1 Percussive Walk Cycle?	No	N/A B 2 Percussive Walk Cycle?	N/A	Yes	B 1 PAR to XWalk?	Yes	N/A
N/A B 1 Extended Press Feature?	No	N/A B 2 Extended Press Feature?	N/A	Yes	B 1 Clear Floor Space?	Yes	N/A
N/A B 1 Tone Audible Range?	No	N/A B 2 Tone Audible Range?	N/A	N/A	B 1 FWD Approach?	No	N/A
				N/A	B 1 FWD Approach Constrained?	No	N/A
				N/A	B 1 FWD Approach Reach (in)	N/A	N/A
				N/A	B 1 FWD Approach Width (in)	N/A	N/A
				N/A	B 1 FWD Approach Obstruction?	Yes	N/A
				N/A	B 1 FWD Approach Obstruction Dist (in)	5.0	N/A
				N/A	B 1 PARA Approach?	Yes	N/A
				N/A	B 1 PARA Approach Constrained?	Yes	N/A
				Yes	B 1 PARA Approach Reach (in)	7.0	N/A
				No	B 1 PARA Approach Width (in)	48.0	N/A
				N/A	B 1 PARA Approach Obstruction?	Yes	N/A
				N/A	B 1 PARA Approach Obstruction Dist (in)	6.0	N/A
				Yes	B 1 Clear Floor Space Slope (%)	0.9	N/A
				No	B 1 Clear Floor Space XSlope (%)	2.8	N/A
				N/A	B 1 PAR Slope (%)	1.7	N/A
				Yes	B 1 Height (in)	41.0	N/A
				Yes	B 1 Pressure (#)	2.0	N/A
				Yes	B 1 Closed Fist Operation?	Yes	N/A
				MUTCD Compliance			
				N/A	B 1 Clear Xing Direction?	N/A	N/A
					B 1 Crossing Direction	To SE	
				Yes	B 1 DistanceTo XWalk (in)	0.0	N/A
				No	B 1 DistanceTo Curb (in)	174.0	N/A
				Yes	B 1 Diameter (in)	2.0	N/A