

Access Compliance Report Public Rights-of-Way (Pedestrian Signals)



N/A

N/A


N/A

Intersection ID: N/A Main Street: Cross Street: N/A Location: N/A

ADA ID: 61DF70AC0F3E Signal Type: One Push Button-Non APS Overall Compliance: No Severity Score: BTN 1:N/A BTN 2: N/A No BTN: N/A

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

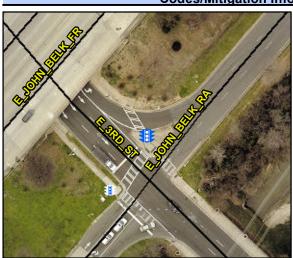

N/A B 1 Extended Press Feature?

N/A B 1 Tone Audible Range?

Possible Solutions: Replace Signal Push Button With APS Button on New Post. Remove & Relocate Sign.

Surveyor Notes: N/A

PROW/ADA: R209.1, TMUTCD 4e.08, R404.7.3, R406

Total Cost:

N/A N/A B 2 Extended Press Feature?

N/A N/A B 2 Tone Audible Range?

650.00



	Con	ompliance Description		Data	Data Compliance Description			
		Button Count		Button1	N/A	Distant t	o Additional Button (in)	N/A
		Additional Button Present? //A Signal Buttons Required?		No		Addition	al Button ID	N/A
	N/A			N/A	N/A	Addition	al Ped Posts Required	N/A
		How Mar	ny Ped Street Xings?	3		Located	In An Island/Median?	Yes
	N/A	B 1 Sign	Present?	Yes	N/A	B 2 Sign	Present?	N/A
	Yes	B 1 Sign	Purpose?	Yes	N/A	B 2 Sign	Purpose?	N/A
	Yes	B 1 Sign	Lettering & Contrast?	Yes	N/A	B 2 Sign	Lettering & Contrast?	N/A
	No	B 1 Para	llel To XWalk?	N/A	N/A	B 2 Para	allel To XWalk?	N/A
	Yes	B 1 PAR	to Button?	Yes	N/A	B 2 PAR	to Button?	N/A
	Yes	B 1 PAR	to XWalk?	Yes	N/A	B 2 PAR	to XWalk?	N/A
	Yes	B 1 Clea	r Floor Space?	Yes	N/A	B 2 Clea	ar Floor Space?	N/A
	N/A	B 1 FWD	Approach?	No	N/A	B 2 FW	O Approach?	N/A
)	N/A	B 1 FWD	Approach Constrained?	N/A	N/A	B 2 FW	O Approach Constrained?	N/A
	N/A	B 1 FWD	Approach Reach (in)	N/A	N/A	B 2 FW	O Approach Reach (in)	N/A
	N/A	B 1 FWD	Approach Width (in)	N/A	N/A	B 2 FW	O Approach Width (in)	N/A
	N/A	B 1 FWD	Approach Obstruction?	N/A	N/A	B 2 FW	O Approach Obstruction?	N/A
	N/A	B 1 FWD	Approach Obstruction Dist	(in) N/A	N/A	B 2 FW	O Approach ObstructionDist (in) N/A
	N/A	B 1 PAR	A Approach?	Yes	N/A	B 2 PAR	A Approach?	N/A
	N/A	B 1 PAR	A Approach Constrained?	No	N/A	B 2 PAR	A Approach Constrained?	N/A

13.0 N/A B 2 PARA Approach Reach (in)

141.0 N/A B 2 DistanceTo Curb (in)

2.0 N/A B 2 Diameter (in)



					N/A B 1 PARA Approach Width (in)	N/A	N/A	B 2 PARA Approach Width (in)	N/A
					N/A B 1 PARA Approach Obstruction	n? Yes	N/A	B 2 PARA Approach Obstruction?	N/A
_		N/A B 1 PARA Approach Obstruction Dist (in		N/A	/A B 2 PARA Approach ObstructionDist (in				
	Is Button 1 APS or Non-APS?	NonAPS	Is Button 2 APS or Non-APS?	N/A	Yes B 1 Clear Floor Space Slope (%) 1.0	N/A	B 2 Clear Floor Space Slope (%)	N/A
N/A	B 1 VibroTact Arrow?	N/A	N/A B 2 VibroTact Arrow?	N/A	Yes B 1 Clear Floor Space XSlope (%) 0.1	N/A	B 2 Clear Floor Space XSlope (%)	N/A
N/A	B 1 VibroTact Parallel to Xing?	N/A	N/A B 2 VibroTact Parallel to Xing?	N/A	N/A B 1 PAR Slope (%)	1.4	N/A	B 2 PAR Slope (%)	N/A
N/A	B 1 VibroTact Contrast	N/A	N/A B 2 VibroTact Contrast	N/A	No B 1 Height (in)	49.0	N/A	B 2 Height (in)	N/A
N/A	B 1 Pilot Light?	N/A	N/A B 2 Pilot Light?	N/A	Yes B 1 Pressure (#)	2.0	N/A	B 2 Pressure (#)	N/A
N/A	B 1 Pilot Light Illumination?	N/A	N/A B 2 Pilot Light Illumination?	N/A	Yes B 1 Closed Fist Operation?	Yes	N/A	B 2 Closed Fist Operation?	N/A
N/A	B 1 Verbal Walk Cycle?	N/A	N/A B 2 Verbal Walk Cycle?	N/A	MUTCD Compliance				
N/A	B 1 Verbal Message Audible?	N/A	N/A B 2 Verbal Message Audible?	N/A	Yes B 1 Clear Xing Direction?	ClearlyMarked	N/A	B 2 Clear Xing Direction?	N/A
N/A	B 1 Locator Tone?	N/A	N/A B 2 Locator Tone?	N/A	B 1 Crossing Direction	To SW		B 2 Crossing Direction	N/A
N/A	B 1 Percussive Walk Cycle?	N/A	N/A B 2 Percussive Walk Cycle?	N/A	Yes B 1 DistanceTo XWalk (in)	0.0	N/A	B 2 DistanceTo XWalk (in)	N/A

N/A

N/A

No B 1 PARA Approach Reach (in)

No B 1 DistanceTo Curb (in)

Yes B 1 Diameter (in)